

## Chapter 6

### DEC/VAX 7xx0/10xx0

This chapter by Dave Bazley....

Revision: Written July 1993, updated January 1994, August 1994, April 1995.

#### 6.1 Introduction

This chapter contains information on the following systems: DEC7xx0, DEC10xx0, VAX7xx0 and VAX10xx0. The basic 7000 and 10000 boxes, or platforms, can be configured to support either VAX architecture (the 32 bit, CISC based one, you know about, that made us great in the '80s) or Alpha AXP architecture (the 64 bit, RISC based one, you've heard about, that's going to make us great again!) The DECxxxx(x) systems are AXP based, the VAXxxxx(x) systems are VAX based.

The 7000s are single cabinet systems and were designed as a replacement for VAX 6000s. For this reason they are described as "departmental" and sometimes termed "VAX 6000 style". However, read on to discover how different they actually are. The 10000s are multi-cabinet systems designed as a replacement for VAX 9000s. They are described as "datacentre" systems.

The fact that all these systems can start off as VAXes and be simply upgraded to AXP's later, makes migrating from one architecture to the other easier for customers.

As additional models and options appear, I expect this chapter to evolve and expand. Any suggestions for improvement would be welcome.

#### 6.1.1 Codenames

System	Code name	Architecture
DEC 7xx0	Laser (Ruby)	Alpha AXP
DEC 10xx0	Blaser (Ruby)	Alpha AXP
VAX 7xx0	Laser (Neon)	VAX/VMS
VAX 10xx0	Blaser (Neon)	VAX/VMS

**LASER:** Light Amplified by Stimulated Emission of Radiation

**BLASER:** Sounds like a jacket, first worn by sailors on HMS Blazer, but actually stands for Big laser.

## 6.2 Sources of information

### 6.2.1 Training

You need to be trained to work on these systems. The VAX 7000 is not "just like a VAX 6000". The only common part is the XMI, which is used only for I/O and has a different backplane, power supply and options. The other 7000/10000 systems are entirely new.

The following courses are available on TIMA or from EDU in your local OLC:

**Table 6-1: Current training**

Course Name	Course No.	Format	Length	Location
Alpha Architecture Concepts	EY-I156E	CBI	1 day	OLC
	EY-K725E			TIMA
DEC/VAX7000/10000 System Maintenance, level 1	EY-I882E	CBI	1 day	OLC
	EY-N402E	CBI (PC)		TIMA
Futurebus+ Concepts	EY-F479E	CBI	1 day	OLC/TIMA
DSSI Concepts	EY-9823E	IVIS	.5 day	OLC
SCSI Concepts	EY-9900E	Book	.5 day	OLC

#### 6.2.1.1 Training notes:

1. The prerequisites for this training are VAX6000 level 1, plus 1 years experience.
2. I've included the DSSI and SCSI courses as these systems are starting to appear in DSSI based clusters.
3. Since none of these courses includes any "hands on", I would recommend that you get some OJT by doing an installation or two with someone who is trained. If possible, do this *before* your first fault call.
4. For engineers who have done one of the above courses, but have not been able to "fill in the gaps" from experience, I have prepared a 1 day seminar. Let me know if you're interested.

#### 6.2.1.2 HOST Training

In addition to the above the following lecture/lab course is currently (Feb-95) available from HOST Computer Systems (a DIGITAL Franchisee):

Course name: VAX 7000 Systems; course number: M379.

### 6.2.2 Documentation

The following manuals are available on Fiche and TIMA. A selection of these manuals can also be found in the Welwyn Technical Library. Some are grouped into kits. The Hardware User Information kit and the Installation kit are supplied with each system, so you should find these manuals on site.

The kits are listed in the first table. The next 3 tables list individual manuals for DEC 7000/10000, DEC/VAX 7000/10000 and VAX 7000/10000. In each case the 7000 (only) manuals are listed first. The last table lists DEC/VAX 10000 (only) manuals. Where the part number is listed as E\*, the \* = K for hardcopy (TIMA) or P for fiche.

### 6.2.2.1 DEC/VAX 7000/10000 Manual Kits

- **DEC7000 AXP/VAX7000 Hardware User Information Kit** , EP-7001B-DK-002, (Fiche)  
Contains: *Operations Manual* , EK-7000B-OP-002 and *Basic Troubleshooting Manual* , EK-7000B-TS-002.
- **DEC7000 AXP/VAX7000 Installation Kit** , EP-7000B-DK-002, (Fiche)  
Contains: *Site Preparation guide* , EK-7000B-SP-002 and *Installation Guide* , EK-700EB-IN-002.
- **DEC10000 AXP/VAX10000 Installation Kit** , EP-1000B-DK-001, (Fiche)  
Contains: *Site Preparation Guide* , EK-1000B-SP-002 and *Installation Guide* , EK-100EB-IN-002.
- **DEC10000 AXP/VAX10000 System Hardware User Information Kit** , EP-1001B-DK-002, (Fiche)  
Contains: *Operations Manual* , EK-1000B-OP-002 and *Basic Troubleshooting* , EK-1000B-TS-002.

### 6.2.2.2 DEC7000/10000 Manuals

- **DEC7000 AXP Pocket Service Guide** , EK-7700A-PG-001, (TIMA)  
Contains: Registers, addressing, some console commands, testing, FRUs, controls and indicators, errors, LFU and ROM information.
- **DEC7000 / 10000 KN7AA CPU Technical Manual** , EP-KN7AA-TM-001, (Fiche)  
Contains: In depth information on 21064 chip, cache, LSB, console, registers, PALcode, VMS and OSF support, initialisation and error handling for AXP CPU module.
- **DEC7000 / 10000 AXP Technical Bulletin No 1** , E\*-70TBA-T1-A01, (TIMA/Fiche)  
Contains: Update information to accompany the release of OpenVMS AXP V1.5. Covers installation, booting and CPU setup.
- **DEC7000 / 10000 AXP Technical Bulletin No 2** , E\*-70TBA-T2-A01, (TIMA/Fiche)  
Contains: Update information to accompany the release of DEC OSF/1 AXP V1.3. Covers booting, using VET and servicing the MS7BB.
- **Alpha AXP Systems Handbook** , (Sales Library)  
Customer book telling all about Alpha AXP. Some interesting stuff on 7000/10000 and other AXP systems. Also covers the chip, the architecture, and some new network and storage products.
- **KN7AA CPU Installation Card** , EK-KN7AA-IN-001. (TIMA)  
A quick guide to installing or replacing a KN7AA (DEC 7600/10600) CPU module.
- **KN7AB CPU Installation Card** , EK-KN7AB-IN-001. (TIMA)  
A quick guide to installing or replacing a KN7AB (DEC 7700/10700) CPU module.
- **KFMSB Adapter Installation guide** , EK-KFMSB-IN-A01. (Library)  
Describes how to install and test the DSSI I/O adapter, KFMSB.
- **KZMSA Adapter Installation guide** , EK-KXMSX-IN-001. (TIMA)  
Describes how to install a SCSI I/O adapter (KZMSA). Also some general SCSI notes.

### 6.2.2.3 DEC/VAX 7000/10000 Manuals

- *DEC7000 AXP/VAX7000 Basic Troubleshooting* , EK-7000B-TS-002, (TIMA)  
Contains: Power up and boot flows, self test info., SHOW and TEST commands, indicators. **Written for operators.**
- *DEC7000 AXP/VAX7000 Console Reference Manual* , E\*-70C0B-TM-002, (TIMA/Fiche)  
Contains: Console hardware, console interface, console commands.
- *DEC7000 AXP/VAX7000 Installation Guide* , EK-700EB-IN-002, (TIMA)  
Contains: Installing system and expander cabinets, connecting Ethernet, FDDI, DSSI and CI, powering up and testing.
- *DEC7000 AXP/VAX7000 I/O System Technical Manual* , EP-7010A-TM-001, (Fiche)  
Describes LSB I/O subsystem in depth, including discussion of IOP module, DWLMA (LAMB) module and DWLAA (FLAG) module.
- *DEC7000 AXP/VAX7000 IPB* , EK-DV700-IP-A01, (TIMA)  
Contains: Illustrated Parts Breakdown (like the old days!).
- *DEC7000 AXP/VAX7000 Operations Manual* , EK-7000B-OP-002, (TIMA)  
Contains: Description of systems, options, controls and indicators, booting, some console commands and LFU information.
- *DEC7000 AXP/VAX7000 Platform Service Manual* , E\*-7000A-SV-001, (TIMA/Fiche)  
Contains: Configuration rules, FRU removal and replacement, FRU list.
- *DEC7000 AXP/VAX7000 Removable Media Install Guide* , E\*-TFRRD-IN-001, (TIMA/Fiche)  
Describes installing and testing a TF85 or RRD42 in a system or expander cabinet.
- *DEC7000 AXP/VAX7000 Site Preparation Guide* , EK-7000B-SP-002 (TIMA)  
Contains: Cabinet size and weight, floor space, environmental and power requirements.
- *DEC7000 AXP/VAX7000 System Service Manual* , E\*-7002B-SV-002, (TIMA/Fiche)  
Contains: Replacing/adding CPUs and memories, CPU setups, using the LFU.
- *DEC7000/10000 AXP/VAX7000/10000 Systems Overview* , EK-71XEA-OV-A01, (TIMA)  
Compares the 4 systems and briefly describes each. Also describes documentation.
- *DEC7000 AXP/VAX7000 Technical Bulletin No 3* , E\*-70TBA-T3-A01, (TIMA/Fiche)  
Contains: Update information to accompany the release of the KA7AB and KN7AB CPUs. Covers upgrading, new registers and servicing KFMSB and MS7AA-FA options.
- *BA654, Disk PIU Installation Guide* , EP-BA654-IN-001, (Fiche)  
Describes installing and testing a DSSI disk PIU in a system or expander cabinet.
- *BA655, SCSI Disk and Tape PIU Installation Guide* , EP-BA655-IN-001, (Fiche)  
Describes installing and testing a SCSI disk and tape PIU in a system or expander cabinet.
- *DWLMA XMI PIU Installation Guide* , E\*-DWLMA-IN-001, (TIMA)  
Describes installing and testing an XMI PIU in a system or expander cabinet.
- *DWMVA VME Adapter Installation Guide* , E\*-DWMVA-IN-002, (TIMA)  
Describes installing and testing a VME Adapter (DWMVA) in a 6000 or 7000/10000 system
- *H7263 Power Regulator Installation Card* , EK-H7263-IN-001, (TIMA)  
A quick guide to installing or replacing an H7263 (48v) Regulator.

- **MS7AA Memory Installation Card** , EK-MS7AA-IN-001, (TIMA)  
A quick guide to installing or replacing MS7AA memory modules.
- **MS7AA Memory Technical Manual** , EP-MS7AA-TM-001, (Fiche)  
Contains: In depth information on memory controller, organisation and transactions, registers, self test and errors.
- **MS7AA-FA Memory Module Service Manual** , EK-MS7AA-SV-A01, (TIMA/Fiche)  
Contains: How to identify and replace a failing SIMM.

#### 6.2.2.4 VAX 7000/10000 Manuals

- **VAX7000 Pocket Service Guide** , E\*-7000A-PG-001, (TIMA/Fiche)  
Contains: Registers, addressing, some console commands, testing, FRUs, controls and indicators, errors, LRU and ROM information.
- **VAX7000 Advanced Troubleshooting** , E\*-7001A-TS-001, (TIMA/Fiche)  
Contains: Powerup and self test with LEDs and console display, diagnostics, parse trees and PSU info. Written for engineers.
- **VAX7000/10000 KA7AA CPU Technical Manual** , EP-KA7AA-TM-001, (Fiche)  
Contains: In depth information on NVAX+ chip, cache, LSB, console, registers, initialisation and error handling for VAX CPU module.
- **KA7AA CPU Installation Card** , EK-KA7AA-IN-001. (TIMA)  
A quick guide to installing or replacing a KA7AA (VAX 7600/10600) CPU module.
- **KA7AB CPU Installation Card** , EK-KA7AB-IN-A01. (TIMA)  
A quick guide to installing or replacing a KA7AB (VAX 7700/10700) CPU module.
- **DWMBB VAXBI PIU Installation Guide** , EK-DWMBB-IN-001, (Library)  
Describes installing and testing a VAXBI PIU in a system or expander cabinet.
- **VMS V5.5-2 7000/10000 CPUs Upgrade and Installation Supplement**, AA-PRAHA-TE, (TIMA)  
Contains: Startup, Shutdown and Backup procedures.
- **OpenVMS V6.0 7000/10000 CPUs Upgrade and Installation Supplement**, AA-PVXTA-TE, (TIMA)  
Contains: Startup, Shutdown and Backup procedures.

### 6.2.2.5 DEC/VAX10000 Manuals

- ***DEC10000 AXP/VAX10000 Site Preparation Guide*** , EK-1000B-SP-002, (TIMA/Fiche [See kits])  
Contains: 4 and 5 cabinet systems, dimensions and weights, space, power and environmental requirements.
- ***DEC10000 AXP/VAX10000 Installation Guide*** , EK-100EB-IN-002, (TIMA/Fiche [See kits])  
Contains: Assembly of cabinets, connection of FDDI, Ethernet, DSSI and CI, powering up and testing.
- ***DEC10000 AXP/VAX10000 Operations Manual*** , EK-1000B-OP-002, (TIMA/Fiche [See kits])  
Contains: Description of systems, options, controls and indicators, booting, some console commands and LFU information.
- ***DEC10000 AXP/VAX10000 Basic Troubleshooting*** , EK-1000B-TS-002, (TIMA/Fiche [See kits])  
Contains: Power up and boot flows, self test info., SHOW and TEST commands, indicators. **Written for operators.**
- ***DEC10000 AXP/VAX10000 System Service Manual*** , E\*-1002A-SV-001, (TIMA/Fiche)  
Contains: Replacing/adding CPUs and memories, CPU setups, using the LFU.
- ***VAX10000 Pocket Service Guide*** , E\*-1000A-PG-001, (TIMA/Fiche)  
Contains: Registers, addressing, some console commands, testing, FRUs, controls and indicators, errors, LFU and ROM information.
- ***VAX10000 Advanced Troubleshooting*** , EP-1001A-TS-001, (Fiche)  
Contains: Powerup and self test with LEDs and console display, diagnostics, parse trees and PSU information. **Written for engineers.**

## 6.3 Descriptions of Systems

The basic building block for all the 7000 and 10000 systems is a single system cabinet called the Laser Platform. Most 7000s consist only of this cabinet, although an expander cabinet can be added. 10000s use the same system cabinet along with 1 or 2 expander cabinets and 1 or 2 battery cabinets. The basic Laser Platform is described first.

### 6.3.1 Laser Platform

#### 6.3.1.1 Logic

Refer to Figure 6-1, Laser Platform Block Diagram.

The basic system interconnect is called the Laser System bus or LSB. This runs on a 9 slot, double sided backplane. On the LSB sit CPUs, Memories and the I/O port (IOP). Each CPU and each memory consists of 1 module and therefore takes up 1 slot. The IOP is also 1 module. The minimum configuration is 1 CPU, 1 memory and 1 IOP. The remaining 6 slots can contain CPUs, up to a maximum of 6, or memories, up to a maximum of 7.

The IOP has 4 ports (aka. hoses) and each can connect to an XMI or Futurebus+. At present this can be up to 4 XMIs or up to 3 Futurebuses and 1 XMI. (1 XMI is currently required for booting). For a description of Futurebus+ see Section 6.5.

The IOP to XMI interface consists of a single XMI module known as a LAMB. Another slot in the XMI is taken up by a CLOCK module. This leaves 12 slots for I/O adapters.

The IOP to Futurebus+ interface is a single module known as a FLAG. This occupies 1 slot in the Futurebus+, leaving 9 for I/O adapters. (LAMB and FLAG? - Sounds like they were dreamt up in the local pub!)

A TF85 (for VAX systems) or RRD42 (for DEC systems) can be fitted, as an optional load device. They connect to the XMI via a KFMSA or KZMSA. Figure 6-1 shows some XMI adapters, for a full list see Section 6.4, XMI Supported Options.

#### 6.3.1.2 Packaging

Refer to Figure 6-2, Laser Platform System Cabinet Layout.

The Laser platform system cabinet is slightly wider and taller than a VAX6000 cabinet. This means you cannot install one in an existing line of VAXes without moving them.


The top of the cabinet contains the LSB card cage and the power system. The LSB card cage has a backplane, which is double sided, in the centre (sometimes called a centrepiece). 4 modules plug in from the front and 5 from the back. The power system has up to 3 plug in regulators at the front and an A/C input box and power distribution at the back.

Also in the top are the Operator Control Panel (OCP) and, behind that the Cabinet Control Logic (CCL) module. The latter provides an interface for the OCP, console and power control logic. The TF85 or RRD42, if present, resides next to the OCP.

In the centre on the cabinet is the Air Mover (or fan to you and me). This draws in air from the top and bottom of the cabinet and expels it in the region of your trousers. This means nothing should be placed on top of the cabinet.

The lower part of the cabinet can house up to 4 Plug-In Units or PIUs. A PIU is basically a self-contained box which can have I/O, storage or batteries in it. Figure 6-2 shows XMI and Disk PIUs, as an example, but several other combinations are possible. See Section 6.3.3, Plug In Units (PIUs) for more information on PIUs.


Figure 6-1: Laser Platform Block Diagram

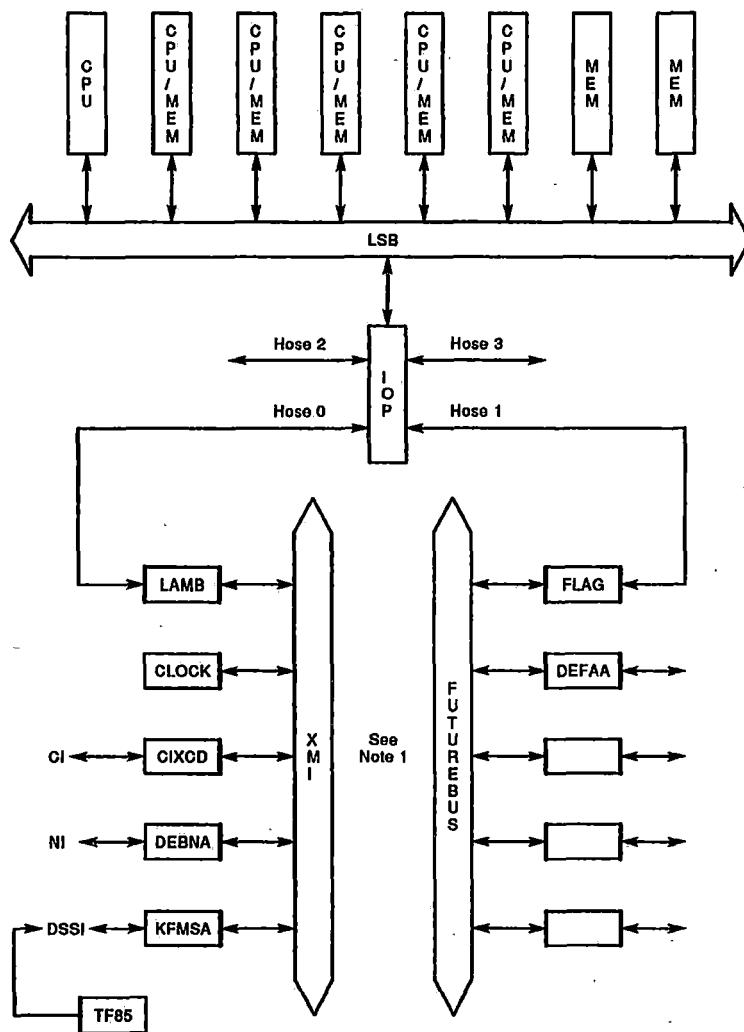

NOTES:

1. XMI = 14 slots, Futurebus+ = 10 slots

Figure 6-2: Laser Platform System Cabinet Layout

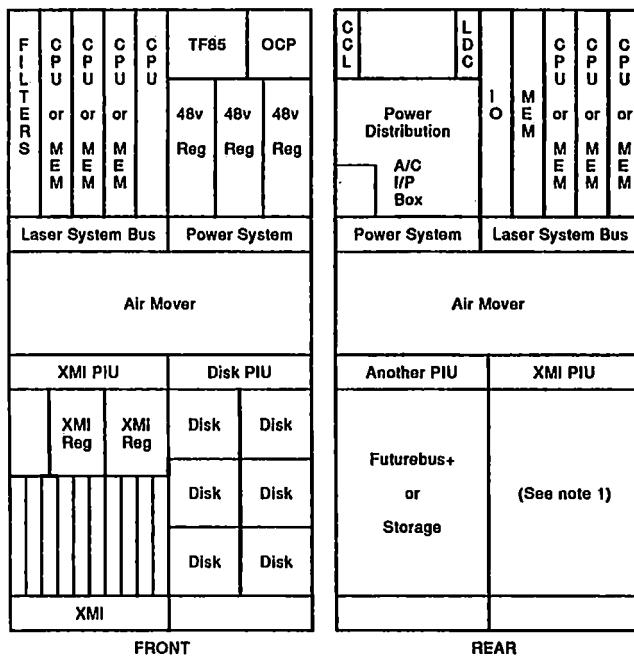

NOTE 1: XMI PIU needs full depth of cabinet for cable access

### 6.3.1.3 Power

Everything on the Laser Platform runs on 48v DC. The LSB modules have DC to DC converters onboard which provide the required logic voltages. Each PIU has its own regulator(s) which generate the required internal DC voltages from the 48v input. The one exception is the battery PIU which uses 48v directly, as does the air mover.

The 48v is provided by up to three 240v AC to 48v Regulators (H7263). The cabinet requires 3 phase mains input, 1 phase supplying each regulator. A fully configured cabinet will run with 2 regulators, thus 3 provides N + 1 redundancy. Most systems seem to come with just 1 regulator, which makes the platform a single phase load. This may mean moving the regulators (and batteries, if fitted) around to balance loads in multiple system installations. See Advanced Troubleshooting Manual, appendix B, for how to calculate when a second regulator is required. ("Base system" = 1 CPU, 1 Memory, 1 IOP, 1 XMI, 1 DEMNA and 1 regulator). See Section 6.3.3.6, Battery PIU for battery information.

Note that, as the cabinet does not have a traditional power controller, there are no switched or unswitched 240v AC outlets. This means a separate socket has to be found for the console.

The console is able to monitor the H7263 regulators and the air mover via the CCL. Thus the status of the power system can be displayed on the console. Future implementations may even extend to errorlog packets being provided for the Operating System!

#### 6.3.1.4 System Modules

Here is a brief summary of current Laser system modules. Note that there are two sorts of CPU Module, one for the VAX7000/10000, and one for the DEC7000/10000 AXP. This is the only real hardware difference between the VAX and AXP systems. See Platform Service Manual for detailed module placement rules.

##### 6.3.1.4.1 CPU Modules

- VAX 7600/10600 CPU Module:
  - + Called KA7AA or LNP (Laser Neon Processor)
  - + Based on NVAX+ CISC chipset
  - + 4MB backup cache
  - + ~40 Specmarks
  - + Part No. = E2045-AA/AB
- VAX 7700/10700 CPU Module:
  - + Called KA7AB
  - + Based on NV5 CMOS-5 CPU chip
  - + 138 MHz clock, ~50% faster than KA7AA CPU
  - + Cannot be mixed with KA7AA
  - + Part No. = E2058-AA
- DEC 7600/10600 AXP CPU Module
  - + Called KN7AA or LRP (Laser Ruby Processor)
  - + Based on 21064, EV4 Alpha RISC chip
  - + 4MB backup cache
  - + ~150-200 Specmarks
  - + Part No. = E2040-AA/YA
- DEC 7700/10700 AXP CPU Module
  - + Called KN7AB
  - + Based on 21064A, EV4\_5 Alpha RISC chip
  - + 275 MHz clock, ~50% faster than KN7AA
  - + Cannot be mixed with KN7AA
  - + Part No. = E2057-AA
- Primary (boot) CPU must reside in slot 0 (LHS, front) of LSB

#### 6.3.1.4.2 Memory Modules

- 64 MB Memory Module (MS7AA-AA), Part no. = E2043-AA
- 128 MB Memory Module (MS7AA-BA), Part no. = E2043-BA
- 256 MB Memory Module (MS7AA-CA), Part no. = E2043-CA
- 512 MB Memory Module (MS7AA-DA), Part no. = E2046-AA
- 2 GB Memory Module (MS7AA-FA), Part no. = ?????-?? (has SIMMs)
- 16 MB BBU Memory Module (MS7BB-AA), Part no. = E2049-AA, for Prestoserve support on DEC OSF/1 AXP systems
- One memory module must reside in slot 7 (next to IOP) of LSB

#### 6.3.1.4.3 IOP Module


- IOPC module, Part no. = E2044-AA
- Only 1 allowed, must be in dedicated slot 8 (LHS, rear) of LSB
- Up to 4 hose (actually flat!) cables out to XMI or Futurebus+

### 6.3.2 Laser Expander Cabinet

Refer to Figure 6-3, Laser Expander Cabinet Layout

The expander cabinet is the same as the system cabinet without the CPU bits. It has no LSB card cage or OCP. In place of the LSB card cage, 2 more PIUs can be installed. Due to weight and cabling restrictions these can only be storage PIUs. A TF85 or RRD42 may be fitted as in the system cabinet. A maximum of 2 expander cabinets is allowed.

Figure 6-3: Laser Expander Cabinet Layout

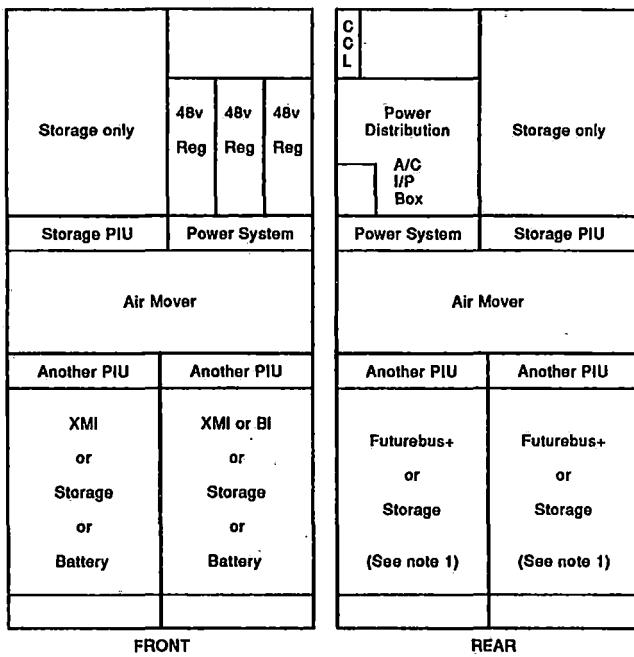

NOTES: 1. XMI, BI and Battery PIUs use the full depth of the cabinet.

### 6.3.3 Plug In Units (PIUs)

See Figure 6-4, Generic PIU Layout


PIUs are currently available to house the following options:

- XMI
- VAXBI
- Futurebus+
- SCSI disks and tapes
- DSSI disks
- Batteries

The cabinet space filled by a PIU is known as a quadrant ('cos 4 can fit in the bottom of a cabinet). However, XMI, VAXBI and battery PIUs take up 2 quadrants (1 front and 1 rear) each. This means that only 2 of these PIUs can be fitted in a cabinet. The Futurebus+ and Storage PIUs only take up 1 quadrant and thus 4 can be fitted in the system cabinet and 6 in the expander.

Each PIU is briefly described below. Most configuration rules are mentioned here, but for the full story see the Platform Service Manual.

Figure 6-4: Generic PIU Layout

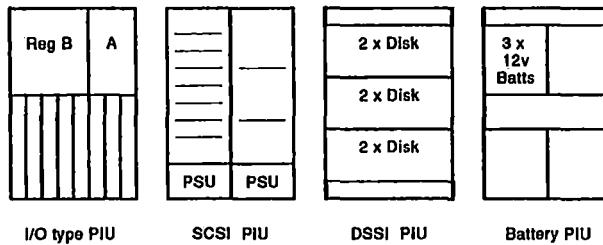

#### 6.3.3.1 XMI PIU

The XMI PIU houses an XMI card cage and regulators. It requires 2 (lower) PIU quadrants to allow cable access to the rear of the XMI backplane. A maximum of 2 per cabinet and 4 per system is allowed.

The XMI backplane has 14 slots. Slots 7 and 8 contain the CLOCK and LAMB modules, leaving 12 slots available for I/O. There is no restriction regarding I/O slots, as in the 6000 XMI, since the arbitration logic has been removed from the backplane and placed on the clock module. The first option must go in slot 1 or 14 to terminate the bus.

See Section 6.4, XMI Supported Options for details on currently supported options.

### 6.3.3.2 VAXBI PIU

*Only supported on VAX7000/10000 systems.*

The VAXBI PIU houses 1 or 2 VAXBI card cages and regulators. It requires 2 (lower) PIU quadrants to allow cable access to the rear of the VAXBI backplanes. A Maximum of 1 per cabinet and 3 per system is allowed. It must be in same cabinet as XMI PIU, XMI on LHS, VAXBI on RHS (from front).

The VAXBI backplanes have 6 slots each. Slot 6 contains the XBIB module, leaving 5 slots for I/O (10 slots total if both cardcages fitted). Note: XBIA+ module must reside in slot 1 of XMI.

See Section 6.4.2, BI Supported Options for details on currently supported options.

### 6.3.3.3 Futurebus+ PIU

*Only supported on DEC7000/10000 systems.*

The Futurebus+ PIU houses a Futurebus+ card cage and regulators. It occupies 1 (lower, rear) PIU quadrant. A maximum of 2 per cabinet and 3 per system is allowed (1 XMI must be present).

The Futurebus backplane has 10 slots. Slot 5 contains the FLAG module, leaving 9 slots for I/O.

See Section 6.5 for a discussion of the Futurebus+ itself.

### 6.3.3.4 SCSI Disk and Tape PIU

*Only supported on DEC7000/10000 systems.*

The SCSI disk and tape PIU houses any combination of 3.5" disk and tape drives and 5.25" disk drives. It occupies 1 (any) PIU quadrant. A maximum of 2 in the system cabinet and 4 in the expander is allowed.

This PIU contains 2 vertical sections (called shelves!) Each shelf has 7 slots for disks or tapes. 3.5" devices, RZ26-VA or TLZ06-VA, use 1 slot. 5.25" devices, RZ73-VA, use 3 slots. To satisfy airflow requirements, the PIU is mounted upside-down if fitted in the top of an expander cabinet.

### 6.3.3.5 DSSI Disk PIU

The DSSI disk PIU houses 1 to 3 disk "bricks". Each brick contains 2 x 5.25" disks (EG: RF73). It occupies 1 (any) PIU quadrant. A maximum of 2 in the system cabinet and 4 in the expander is allowed. To satisfy airflow requirements, disk bricks are installed starting closest to the blower and working down (or up). Also, the PIU is mounted upside-down if fitted in the top of an expander cabinet.

### 6.3.3.6 Battery PIU

The battery PIU houses 1 to 3 battery blocks. Each block contains 4 x 12v batteries. 1 block is required for each 48v regulator. This PIU requires 2 (lower) PIU quadrants due to it's size and weight. A maximum of 1 per cabinet is allowed. If the 48v regulators are reconfigured for phase balancing (see Section 6.3.1.3, Power ), then the batteries must also be reconfigured. See Platform Service Manual for more details.

The batteries are used as a UPS rather than BBU. They supply power to everything in the cabinet and provide 'ride-through' for short duration power outages. On a fully configured 7000 system they provide a UPS for 10 minutes. On a 10000 system special half-width battery cabinets are supplied, containing sufficient battery PIUs to provide a UPS for 1 hour.

### 6.3.4 Who's who of 7000/10000 systems

This table lists the 7000 and 10000 systems currently available. The following naming and numbering conventions are used:

- DEC means Alpha AXP system based on RISC CPU (KN7Ax)
- VAX means VAX/VMS system based on CISC CPU (KA7Ax)
- 7xxx means departmental, typically single cabinet
- 10xxx means datacentre, at least 4 cabinets
- x6xx and xx6xx means first chip technology, (NVAX+ for VAX, EV4 for AXP)
- x7xx and xx7xx means second chip technology, (NV5 for VAX, EV4\_5 for AXP)
- xxnx and xxxnx, where n can be 1 to 6, means number of CPUs

EG: A VAX 7610 is a single cabinet, first technology, single CPU, VAX/VMS system.

Table 6-2: Who's who

DEC 76n0	System cabinet. 1 to 6 AXP CPUs, rated at 180 Specmarks each. Up to 14 GB of memory. Runs OpenVMS AXP and DEC OSF/1. Options include: Expander cabinet for more I/O, storage or UPS.
DEC 77n0	As DEC 76n0, but with 50% faster CPUs. Needs OpenVMS AXP V6.1 or DEC OSF/1 V3.0.
DEC 106n0	System cabinet + expander cabinet + 2 battery cabinets. 1 to 6 AXP CPUs, rated at 200 Specmarks each. Up to 14 GB of memory. N + 1 power system and UPS (2 x battery cabs) standard. Runs OpenVMS AXP and DEC OSF/1. Options include: Another expander cabinet for even more I/O or storage.
DEC 107n0	As DEC 106n0, but with 50% faster CPUs. Needs OpenVMS AXP V6.1 or DEC OSF/1 V3.0.
VAX 76n0	System cabinet. 1 to 6 VAX CPUs, rated at 40 Specmarks each. Memory limited by VMS (512 MB with v5.5, 2 GB with v6.x.) Can be upgraded to DEC 76n0. Runs OpenVMS VAX. Options include: Expander cabinet for more I/O, storage or UPS.
VAX 77n0	As VAX 76n0, but with 50% faster CPUs. Needs OpenVMS VAX V6.1
VAX 106n0	System cabinet + expander cabinet + 2 battery cabinets. 1 to 6 VAX CPUs, rated at 40 Specmarks each. Memory limited by VMS (512 MB with v5.x, 3.5 GB with v6.x.) N + 1 power system and UPS (2 x battery cabinets) standard. Can be upgraded to 106n0. Runs OpenVMS VAX. Options include: Another expander cabinet for even more I/O, storage.
VAX 107n0	As VAX 106n0, but with 50% faster CPUs. Needs OpenVMS VAX V6.1

## 6.4 XMI Supported Options

The following tables list current supported XMI options for DEC 7000/10000 and VAX 7000/10000 systems.

Table 6-3: DEC 7000/10000 - XMI Options

Option	Adapter type	Max per XMI (OVMS)	Max per System (OVMS)	Max per XMI (OSF)	Max per System (OSF)	Min firmware rev
CIXCD ①	CI	2		1		1.0 [0111] ②
DEMFA	FDDI LAN	4	4	4	8	1.4 [0514]
DEMNA	NI LAN	4	4	4	8	8.02 [0802]
KDM70	RA/TA/ESE	3	12	3	6	3.00 [1E11]
KFMSB ③	DSSI	6	6			1.0
KZMSA ④	SCSI	4	6	8	8	4.6

- ① Must be CIXCD-AC (T2080-YA). Note, different ucode for AXP and VAX.
- ② Figures in [ ] show how revision appears in SHOW CONFIG display.
- ③ Needs console V3.2 and OVMS AXP V6.1. Not supported on DEC OSF/1?
- ④ DEC 7000/10000 only, no VAX equivalent

Table 6-4: VAX 7000/10000 - XMI Options

Option	Adapter type	Max per XMI	Max per System	Min firmware rev
CIXCD ①	CI	4	10	70.00 [4611]
DEMFA	FDDI LAN	4	7	1.4 [0514]
DEMNA	NI LAN	4	16	8.02 [0802]
DWMBB	BI	1	3	
DWMVA	VME bus			
KCM44	CSS high end tape			
KDM70	RA/TA/ESE storage	3	12	3.00 [1E11]
KFMSA ②	DSSI	5	12 ③	5.06 [A2A6]

- ① Must be CIXCD-AC (T2080-YA). Note, different ucode for AXP and VAX.
- ② Must be KFMSA-BA (T2036-Ax)
- ③ Assumes 1 x CIXCD. Otherwise, maximum = (25 - No of CIXCDs) / 2

#### 6.4.1 Unsupported XMI options

The following XMI options are **not supported** on DEC/VAX 7000/10000 systems. Be careful if upgrading from a 6000 to a 7000, you **cannot** transfer these modules.

Option	Adapter type	Module	Comment
CIXCD	CI	T2080	Use CIXCD-AC (T2080-YA)
DWMBA	BI	T2012	Old BI adapter, use DWMBA
DWMUA	Unibus		Mythical XMI to Unibus adapter?
KFMSA-AA	DSSI	T2036	Old DSSI adapter, use KFMSA-BA

#### 6.4.2 BI Supported Options

The following options are currently supported on VAX7000/10000 systems running OpenVMS V6+. The BI is not supported on DEC7000/10000 systems.

- DMB32, async. and printer ports **only**
- DRB32
- KRB01 - special encryption module, as used by Camelot
- Nothin' else!

#### 6.4.3 Unibus Support

Don't even think about it!

## 6.5 Futurebus+

### 6.5.1 Concept

The Futurebus+ is "a high-performance, asynchronous bus designed by the IEEE 896 committee to allow scalable, technology-independent protocols for many generations of computer architectures". This means it's truly open and not based on any particular vendor's existing products. It has the following features:

- High throughput: 750 MB/sec for 64-bit mode, 1.5 GB/sec for 128-bit mode
- 64 bit address space
- Technology, architecture and vendor independence
- Data Integrity ensured by superior electrical characteristics
- Wide industry support

To support all this openness, many different aspects of bus protocol have to be defined. To simplify matters and ensure compatibility between different products, these definitions are grouped into "profiles". The following profiles are currently specified:

Profile A: The general purpose, cache coherent CPU environment. (IE: A system bus).

Profile B: The I/O bus noncoherent environment. (IE: An I/O bus).

Profile F: A bus for high-performance packet-mode processors.

On DEC 7000/10000 systems Futurebus+ Profile B is used as an I/O bus. A brief description of the hardware involved is given below. For a detailed explanation see the DEC 7000 AXP/VAX 7000 I/O System Technical Manual. For more on concepts do CBI (see Section 6.2.1, Training).

### 6.5.2 Hardware

See Figure 6-4, Generic PIU Layout

The Futurebus+ consists of a 10 slot backplane and card cage, plus regulators. These make up the Futurebus+ PIU. Slot 5 is dedicated to the DWLAA (aka. FLAG) module. If this module is not present the box will not power up.

The DWLAA provides the interface between the Futurebus+ and the LSB. It contains a hose interface (to the LSB), a Futurebus+ interface, Futurebus+ arbitration logic plus other logic required for the Profile B implementation.

#### 6.5.2.1 Futurebus+ Options

The following table lists current options for the Futurebus+. For more information see Alpha AXP Systems Handbook.

Interconnect	Vendor	Description
FDDI	DEC	DEFAA, adapter for Fibre Distributed Data Interface (FDDI). Something to do with networks
HiPPI	Aeon System Inc., Myriad Logic	Adapter for High Performance Parallel Interface (HiPPI). Used for storage, computer interconnections and networks.
IPI	GENROCO Inc.	Adapter for Intelligent Peripheral Interface (IPI). Used for disk storage.
VMEbus	Cable and Computer Technology, Nanotek	Bridge to IEEE VMEbus. Used for analog and disk I/O and networks

## 6.6 Console

DEC/VAX 7000/10000 systems have an "imbedded" console, similar to that of the 6000 series. At initialisation, the primary CPU "wins" the console RX and TX lines. It loads the console code (actually an UNIX-based Operating System) from its Flash ROM into main memory. When this runs, you get the >>> prompt.

From now on it's like any other console, except that the command syntax is different (of course!) It's case sensitive, it uses "-" for flags, it's UNIX! See Pocket Service Guide and Console Reference Manual for command descriptions.

The Flash ROM also contains other code. (EG: ucode patches, PALcode). Any changes to this or the console code require a complete reload of the Flash ROM. This is achieved using the Laser Firmware Update (LFU) utility. See Section 6.7. In a multi-CPU system, do not use the console UPDATE command until you've read this section.

See Section 6.14, Known Features, Restrictions and Problems for known console problems

### 6.6.1 Current versions

Current versions of consoles you may meet are listed below along with some of their "features". Please read the individual release notes for more details. I have included their locations in case you need a particular version in a hurry. A copy of the latest version is kept in the Datadoc Media Cupboard for those of you at Newmarket and Welwyn.

#### 6.6.1.1 DEC versions

- DEC 7000/10000 V2.1
  - LFU image called AXP7000\_V04
  - 1st release in the field, no longer supported
- DEC 7000/10000 V2.4/2.5
  - LFU image called AXP7000\_V06
  - 1st update, no longer supported
- DEC 7000/10000 V2.5
  - CD: *Alpha AXP System Firmware Update V2.5*, part no: AG-PTMWG-BE
  - or: *Alpha AXP System Firmware Update V2.4*, part no: AG-PTMWF-BE
  - LFU image called AXP7000\_V07
  - PALcode = 5.41-5/1.28-9
  - Contains all fixes from previous versions
  - Minimum supported version (at Jun 94)
- DEC 7000/10000 V3.0
  - CD: *Alpha AXP System Firmware Update V2.6*, part no: AG-PTMWH-BE
  - Available from TIMABOX TOOLS as "Alpha AXP Systems Firmware Update CD (Rev 2.6) AG-PTMWH-BE"
  - or: *Alpha AXP System Firmware Update V2.7*, part no: AG-PTMWJ-BE
  - LFU image called AXP7000\_V08
  - PALcode = 5.44-1/1.32-3
  - Required for PRESTOSERVE
- DEC 7000/10000 V3.1
  - CD: *Alpha AXP System Firmware Update V2.7*, part no: AG-PTMWJ-BE
  - or: *Alpha AXP System Firmware Update V2.8*, part no: AG-PTMWK-BE
  - LFU image called AXP7000\_V09
  - PALcode = 5.47-1/1.34-2

- DEC 7000/10000 V3.2
 

CD: *Alpha AXP System Firmware Update V2.8*, part no: AG-PTMWK-BE  
   or: *Alpha AXP System Firmware Update V2.9*, part no: AG-PTMWL-BE  
   LFU image called AXP7000\_V0A  
   PALcode = 5.48-1/1.35-1  
   ">>> set host ... " does not work
- DEC 7000/10000 V4.0
 

CD: *Alpha AXP System Firmware Update V2.9*, part no: AG-PTMWL-BE  
   or: *Alpha AXP System Firmware Update V3.0*, part no: AG-PTMWM-BE  
   LFU image called AXP7000\_V0B or AXP7000\_V0C  
   PALcode = 5.48-2/1.35-1  
   1st release to support KN7TAB (7700/10700 CPUs) too  
   Incompatible with AXP7000\_V09, downgrade via AXP7000\_V0A  
   ">>> set host ... " and ">>> CDP ... " now OK again
- DEC 7000/10000 V4.1
 

CD: *Alpha AXP System Firmware Update V3.1*, part no: AG-PTMWN-BE  
   LFU image called AXP7000\_V0D  
   PALcode = 5.48-2/1.35-2  
   Incompatible with AXP7000\_V09, downgrade via AXP7000\_V0A  
   Boot support for HSD05 and HSD30 (but not CDP)

#### 6.6.1.2 VAX versions

- VAX 7000/10000 V1.2
 

LFU image called VAX7000\_V02  
   1st release in the field, no longer supported
- VAX 7000/10000 V2.4
 

2nd release to field, console CD part no: AG-PQW1C-RE  
   Secondary CPUs not joining SMP (aka. NPAGEDYN problem) fixed  
   Available from TIMABOX TOOLS as "VAX 7000/10000 Console CD and FW Release Notes (Rev C) (FIRMWARE)"  
   LFU image called VAX7000\_V04
- VAX 7000/10000 V2.6
 

Minor upgrade to V2.4, not released on CD  
   V2.5 did not hit the field, this release includes V2.4 to V2.5 changes  
   Contains PCS patch for NVAX+ chip to fix INSQTI bug under SMP  
   Contains fix for booting large capacity (>2 GB) disks  
   Available from VEX::REPOSITORY\$:[NEON\_RELEASED.CONSOLE.V2\_6]  
     V26\_RELEASE\_NOTES.TXT (includes V2.5 release notes)  
     VAX7000\_V06.EXE (WRITEBOOT-able LFU image)  
     VAX7000\_V06.SYS (MOP-loadable LFU image)
- VAX 7000/10000 V3.0
 

Major release, fixes many problems and adds new features  
   Boot command changed  
   Console CD part no: AG-PQW1D-BE  
   Available from VEX::REPOSITORY\$:[NEON\_RELEASED.CONSOLE.V3\_0]  
     V30\_RELEASE\_NOTES.PS  
     V30\_RELEASE\_NOTES.TXT  
     VAX7000\_V07.SYS (MOP-loadable LFU image)  
   Available from TIMABOX TOOLS as "VAX 7000/10000 Console CD (Rev D) (FIRMWARE)"

- VAX 7000/10000 V3.1
 

Minor upgrade to V3.0, not released on CD  
   Controller-based shadow set problem (ds.. in BOOTDEF\_DEV) fixed  
   Console now recognises all EFxx disk drives  
   Available from PROXY"fa!\$access":LASER\_CONS\_PUBLIC:[PUBLIC]  
     VAX7000\_V08.SYS (MOP-loadable LFU image)
- VAX 7000/10000 V3.2
 

Minor upgrade to 3.2, not available on CD (after all)  
   Contains fix for HSJ-40 reboot problem, plus fixes in V3.1  
   Needs patch for "single path HSJ40" problem  
   Available from PROXY"fa!\$access":LASER\_CONS\_PUBLIC:[PUBLIC]  
     VAX7000\_V07\_2.SYS (MOP-loadable LFU image, CPU code only)
- VAX 7000/10000 V3.3
 

Latest version of 3.\*, not available on CD  
   Contains fix for "single path HSJ40" problem, so patch no longer required  
   Contains fix for dual-path system disk shutdown problem, new variable: BOOT\_ALT  
   Available from PROXY"fa!\$access":LASER\_CONS\_PUBLIC:[PUBLIC]  
     VAX7000\_V07\_3.SYS (MOP-loadable LFU image, CPU code only)  
     VAX\_V33\_RELEASE\_NOTE.TXT
- VAX 7700/10700 V1.0
 

1st version of console for KA7AB (77x0/107x0 CPUS)  
   Image not released to field, may be seen on early modules  
   LFU image called VAX7700\_V01  
   Cannot be used for KA7AA (76x0/106x0 CPUS)
- VAX 7700/10700 V1.1
 

1st release of console for KA7AB (77x0/107x0 CPUS)  
   Contains fix for PUST failures in multiple CPU systems  
   LFU image called VAX7700\_V02  
   Cannot be used for KA7AA (76x0/106x0 CPUS)  
   Console CD part no: AG-Q8GNB-BE  
   Available from PROXY"fa!\$access":LASER\_CONS\_PUBLIC:[PUBLIC]  
     VAX7700\_V02.SYS (MOP-loadable LFU image)  
     VAX7700\_V02.EXE (WRITEBOOT-able LFU image)  
     VAX7700\_FW\_REL\_NOTES\_V02.TXT
- VAX 7000/10000 V4.0
 

Major release, fixes a bunch of StorageWorks and other problems  
   Same version supports 76xx and 77xx systems  
   Console CD part no: AQ-PQW1E-BE  
   LFU image called VAX7000\_V09  
   Available from VESDAT:DISK\$PUBLIC:  
     VAX7000\_V40\_FW.EXE (WRITEBOOT-able LFU image)  
     VAX7000\_V40\_FW.SYS (MOP-loadable LFU image)  
     VAX7000\_V40\_REL.PS/TXT

## 6.7 Laser Firmware Update (LFU) utility

This one utility is used for loading all firmware on the Laser platform. At present this means any loadable firmware for LSB and XMI options. Ideally, when a new console version is released, it comes on a CD which contains the latest version of the LFU along with the latest versions of all the firmware. This prevents the compatibility problems that previous ucode update utilities have suffered from.

For a description of the various ways of booting the LFU, see Section 6.7.2

Once the LFU is booted, it displays a menu of the following options:

Function	Description
Display	Displays the system's configuration table
Exit	Return to >>> (system reinitialises)
List	Lists the device types and firmware revisions supported by this version of LFU
Modify	Modifies port parameters and device attributes
Show	Displays device mnemonic, hardware and firmware revisions
Update	Replaces existing firmware with loadable data image
Verify	Compares loadable and existing device images
? or Help	Displays menu

So you can see what's in the system, compare it with what's on the CD and update if necessary. See Pocket Service Guide and/or console Release Notes for exact use of LFU commands.

The latest version of VAX LFU is V09. This comes with console V4.0 and supports the following devices:

**Table 6-5: VAX7000\_V07 LFU devices and revisions**

Device	Hardware Rev.	CD Firmware Rev.
CIKCD	All	71.0
DEMFA	All	2.0
DEMNA	All	8.3
KA7AA	All	4.0 (76xx console rev.) †
KA7AB	All	4.0 (77xx console rev.) †
KCM44	All	3.1
KDM70	All	4.4
KFMSA	A01 to A04	5.1
KFMSA	B01 to B04	5.6

†Latest (Apr 95) console revision = 4.0

The latest version of the AXP LFU is V0D. This comes with console V4.1 and supports the following options:

**Table 6-6: AXP7000\_V0D LFU devices and revisions**

Device	Hardware Rev.	CD Firmware Rev.
CIXCD	All	4.0
DEFAA	All	1.0
DEMFA	All	2.0
DEMNA	All	8.3
KCM44	All	3.1
KDM70	All	4.4
KFMSB	Rev. B01	1.0
KFMSB	Rev. C02	2.3
KN7AA	All but rev.K ①	4.1 (console rev)
KN7AB	All	4.1 (console rev)
KZMSA	Rev. F and above ②	5.6

- ① KN7AA rev. K is not supported after 2.4 (console rev). This causes the "ERROR: KN7AA Firmware revision 0.0 Image failed checksum" message when the LFU boots.
- ② KZMSA rev. E or earlier does not have ucode loadable via LFU. It will work OK with old (rev. 3.15) ucode but see Section 6.13, FCOs .

### 6.7.1 Important considerations when using the LFU

The LFU makes upgrading firmware on Laser platform devices fairly easy and safe, provided a few points are taken into account:

1. On most of the modules the firmware is stored in a Flash ROM. This is a serial device which has to be completely loaded every time, in one go. Therefore, the LFU update must not be interrupted. If it is, the module can be left in a completely unuseable and unrecoverable state. If this happens it has to be replaced. This implies a very slight risk to every update due to power failure etc.
2. Upgrading the firmware on the CPU module(s) requires special care. This firmware includes parts which affect the Operating System as well as the hardware. This means the revisions of software and hardware must be taken into account. EG: You could change the firmware to fix a hardware bug and then find OSF/VMS won't boot due to a PALcode mismatch (an extreme case to make the point!) The SID also gets changed.
3. In a multi-CPU system, all CPUs must have the same firmware revision. There is a console UPDATE command which copies the contents of the Flash ROM from one CPU module to another. However, this does not always work between different revisions. So if you're changing the firmware revision always use the LFU.
4. Point 3 becomes especially interesting when a CPU module in a multi-CPU system has to be replaced. The new one may be at a different firmware revision to the originals. Therefore, the LFU will be required to bring them all into line. *Therefore, the correct version of LFU must be available on site.*
5. The CPUs also have an EEPROM. The image in this has to match the Flash ROM. You have to "build" the EEPROM every time the Flash ROM is updated, (see console Release Notes).
6. Some other modules have a SEEPROM (serial EEPROM). At console V3.0, this also has to be "built" after a console upgrade. Various serial number type information may be required, (see console Release Notes).
7. If you skip versions when upgrading consoles, you must read the release notes for the skipped versions to be aware of all changes. Also, some versions are only compatible with the next, and so may not boot if there is a gap. This applies to downgrading too; you may have to step up or down through each version. The bottom line, as always, is: read the release notes!

### 6.7.2 Booting the LFU

If your system has a console RRD42, you can boot the console or update CD from that (see below), if not you need to find an Infoserver. See Section 6.8.1, Booting a 7000/10000 from a CD in an Infoserver.

If your "console or update CD" is on tape, see Section 6.8.2, Putting a service on the Infoserver system disk, or Section 6.7.2.3, Booting the LFU from another system.

#### 6.7.2.1 Booting the LFU from the console RRD42

This is the simplest method, but is restricted to DEC 7000/10000s as (normally) only these have RRD42s. As the "Alpha AXP Systems Firmware Update CD" has code for all Alpha systems on it, you have to specify the bootfile.

1. Load the Update CD into the console RRD42
2. At DEC 7000 >>> boot -flag 0,80 dlxn.n.n.n.n  
do >>> show device kzmsa\* to find device name
3. After the initial bootstrap has loaded, you are asked for the Bootfile

4. Bootfile: [DEC7000]AXP7000\_Vnn.EXE

nn = version number. There is a separate [DEC10000]AXP10000\_Vnn.EXE file  
For V2.5 and earlier the file has a .APB extension

5. The LFU banner and menu appears

#### 6.7.2.2 Booting the LFU from a local disk

The AXP LFU can be booted from a local disk on a DEC 7000, assuming it's running OpenVMS AXP, like this:

1. With the system up, copy AXP7000\_Vnn.EXE to SYS\$SYSTEM
2. Shut down the system and boot from the system disk with boot flags 0,80
3. At the Bootfile: prompt, type AXP7000\_Vnn.EXE
4. The LFU banner and menu appears

The VAX LFU can be booted from a local disk on a VAX 7000, like this:

1. With the system up, choose the local disk. Do not use the system, or any other currently bootable disk, as the pointer to VMB will be lost.
2. Copy VAX7000\_Vnn.EXE to DISK:[DIR] (your chosen disk and directory)
3. Use Writeboot to write the boot block to point to the LFU file:  
    \$ MC Writeboot  
    Target system device (and boot file if not VMB.EXE): DISK:[DIR]VAX7000\_Vnn.EXE  
    Enter VBN of boot file code (default is 1): (take default)  
    Enter load address of primary bootstrap in HEX (default is 200: (take default)
4. Shut down the system
5. Boot your chosen disk:  
    boot -flags 0,0,0 DISK (EG: DUA2.0.0.4.0)
6. The LFU banner and menu appears

#### 6.7.2.3 Booting the LFU from another system

The latest Infoservers do not have a system disk so the procedures described in Section 6.8.2 are no use. The only way to load a "network copy" of the LFU in this situation, is from another system somewhere on the network:

1. Copy the appropriate .SYS file (VAX7000\_Vnn.SYS or AXP7000\_Vnn.SYS) into the MOM\$LOAD directory of the chosen system. You will find this directory on any system which is setup to downline load Decservers etc.
2. Check that the system has "service enabled", using NCP> SHOW CIRCUITS.
3. Boot just as you would if the image were on an Infoserver:  
    >>> boot -flags 0,0,0 exa0 -file VAX7000\_Vnn ; for VAX systems (nn = version)  
    or  
    >>> boot -flags 0,0,0 exa0 -file AXP7000\_Vnn ; for AXP systems (nn = version)
4. The LFU banner and menu appears.

Obviously, you could always use this method and ignore the Infoserver. However, remember that you may need the LFU at any time, and it is arguably less likely to be lost from an Infoserver.

## 6.8 Infoserver

As a TF85 or RRD42 is only an option on the Laser platform, most have no console media. Therefore, booting the LFU and initial S/W installation has to be done from an Infoserver. The Infoserver is basically a small VAX with 1 or 2 CD readers, connected to Ethernet. It "serves" the CDs to other systems on the network. Thus, you can boot your 7000/10000 from it's console CD in the Infoserver.

**NOTE:** The Infoserver must be running kernel software version 2.2 or later. Do INFO SERVER> show server, to check.

To load an image not on a CD see Section 6.8.2, Putting a service on the Infoserver system disk and Section 6.7.2.3, Booting the LFU from another system .

### 6.8.1 Booting a 7000/10000 from a CD in an Infoserver

#### 6.8.1.1 Booting the VAX LFU

Here is an example of loading the LFU for a VAX 7000/10000 from a CD in an Infoserver.

1. Load CD into Infoserver
2. At VAX7000 >>> boot -flags 0,0,0 exa0 -file ISL\_LVAX\_V07
  - exa0 is ethernet device (fxa0 for DEMFA (FDDI) adapter)
  - ISL\_LVAX\_V07 is the name of the file to be loaded and is *different* for each version. It decodes as Initial System Load, Large VAX, version 7. Unfortunately the version number is not the same as the console version number (V3.0 in this case), and not always the same as the LFU version number either (see Release Notes)
3. If all goes well, the "Network Initial System Load Function" banner appears, and a menu of functions is displayed.
4. Select 3, "Choose Service"
5. A number of services will be displayed, depending on how many Infoservers are present and how many services they offer
6. Select the one called "VAX7000\_V07"
7. The LFU is loaded and it's banner and menu appears
8. If you wanted to load something else, you could choose a different service at step 6.

#### 6.8.1.2 Booting OpenVMS VAX Standalone BACKUP

Here is an example of loading Standalone BACKUP from the OpenVMS VAX distribution CD.

1. Load CD into Infoserver
2. At VAX7000 >>> boot -flags 0,0,0 exa0 -file ISL\_LVAX\_060
  - See release notes for specific file name, which must be in uppercase
3. After the ISL has loaded, select function 3, "Choose Service"
4. Select the VMS service you want (VMS060 in this example)
5. The "OpenVMS VAX ..." banner appears

### 6.8.1.3 Booting the AXP LFU

In this case an initial system loader is not used, and the LFU image is loaded directly.

1. Load CD into Infoserver
2. At DEC7000 >>> boot exa0 -file AXP7000\_Vnn  
nn = version number. Device = ffa0 for DEFAA (FDDI) adapter
3. LFU banner and menu appears

### 6.8.1.4 Booting OpenVMS AXP Standalone BACKUP

Same as OpenVMS VAX, except different ISL filename:

1. Load Open VMS AXP Distribution CD into Infoserver
2. At DEC7000 >>> boot exa0 -flags 0,0 -file APB\_015
3. "Choose Service" etc...

## 6.8.2 Putting a service on the Infoserver system disk

Sometimes we don't have the image we want to load, via an Infoserver, on CD. This is often the case with the latest console version, which can be obtained from ENET long before the CD is available. The way round this is to put the image on the Infoserver's System disk and make it look like just another service. For this you need a terminal connected to Infoserver to act as a console. You also need access to a VAX somewhere on the same network as the Infoserver. See VAX 6000 chapter, Section 1.10.9.3, Hints and tips about Infoservers .

The following example creates a new version of VAX LFU (the procedure is the same for AXP LFU).

1. Copy Saveset of VAX 7000/10000 console CD (from TIMA) to tape.
2. At the Infoserver: †
  - Create partition on system disk for console image:  
INFO SERVER> Create partition dk1:VAX7000\_Vnn blocks NNNN †  
INFO SERVER> Show partition dk1:
  - Create temporary service for this partition:  
INFO SERVER> Create service temp1 for dk1:VAX7000\_Vnn
3. At the VAX:
  - Use BACKUP to unpack the saveset into SYSMAINT.
  - Check for "client software":  
\$ Show device dad,  
Now have DADO
  - If not present load it:  
\$ @sys\$startup:ess\$startup client  
\$ Show device dad  
Now have DADO
  - "Bind" partition on infoserver disk to "client software":  
\$ mcr ess\$ladep bind/write\_enable temp1  
This creates logical unit DAD1

† nn = version, NNNN = size of VAX7000\_Vnn.SYS (in blocks)

- Mount it:  
  \$ mount/for DAD1  
  \$ show device dad  
  Now have DAD0 and DAD1
- Copy image to partition:  
  \$ Copy/contig VAX7000\_Vnn.sys dad1:/\*  
  \$ dism dad1

4. Back at infoserver:

- Delete temporary service:  
  INFOSERVER> Delete service temp1

- Enable partition to BOOT:  
  INFOSERVER> Set partition dk1:VAX7000\_Vnn mop enable  
  INFOSERVER> save  
  INFOSERVER> sho partition dk1:

5. LFU image is now on infoserver and can be booted over the network.

#### 6.8.2.1 Booting the LFU from the Infoserver system disk

Once the LFU image is on the Infoserver system disk (see Section 6.8.2), it is booted as follows. This is slightly different to booting from the console CD in that the Initial System Loader is not used. Because the image was "mop enabled" it can be loaded directly:

>>> boot -flags 0,0,0 exa0 -file VAX7000\_Vnn ; for VAX systems (nn = version)


>>> boot -flags 0,0,0 exa0 -file AXP7000\_Vnn ; for AXP systems (nn = version)

You don't get the menu of services (as per ISL\_VAX etc.), The LFU banner and menu appear directly.

## 6.9 RDC

Figure 6-5 shows how to connect a 7000/10000 system to RDC. The MDS01 baud rates should be set to 9600 for the console line (T switches) and 1200 for the modem line (M switches). See VAX 6000 chapter, Section 1.9.9, RDC installation for more information on MDS01 and modem setup.

Figure 6-5: Connecting to RDC

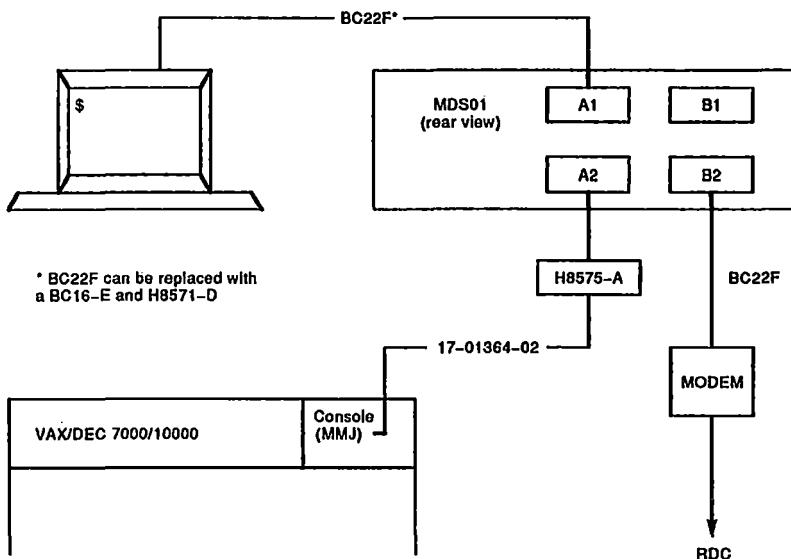

## 6.10 Parts and FRUS

The following tables are from the Product Service Plans. If you can't find a part here look in the IPB.

Table 6-7: Laser LSB and Platform parts

Part Number	Mnemonic	Description
E2045-AA	KA7AA	VAX (NEON) 7600 CPU Module (for 7610 -> 7640)
E2045-AB	KA7AA	VAX (NEON) 7600 CPU Module (for 7650 -> 7660)
E2045-YA	KA7AA	VAX (NEON) 10600 CPU Module
E2058-AA	KA7AB	VAX 7700/10700 CPU Module
E2040-AB	KN7AA	DEC (Ruby) 7600 CPU Module (Old, 180 Mhz)
E2040-YA	KN7AA	DEC (Ruby) 7600/10600 CPU Module (200 Mhz)
E2057-AA	KN7AB	DEC 7700/10700 CPU Module
E2044-AA		IOPC Module
E2043-AA	MS7AA-AA	64Mb Memory Module
E2043-BA	MS7AA-BA	128Mb Memory Module
E2043-CA	MS7AA-CA	256Mb Memory Module
E2056-AA	MS7AA-DA	512Mb Memory Module
E????-??	MS7AA-FA	2Gb Memory Module
54-21718-01		64 Mb SIMM for MS7AA-FA
E2049-AA	MS7BB-AA	16MB BBU Memory
TK85-BX		Tape Drive
RRD42-AA		CDROM (AXP only)
12-35173-01		Main Blower Assembly
12-39865-01		Replacement battery for MS7BB
30-33796-02	H7263	Bulk Regulator (Europe,GIA,Japan)
30-33798-02		AC Input Box (Europe & GIA)
30-35143-01		DC Dist. Assy (Subrack)
54-19089-01		TF85 Controller
54-20300-01	CCL	Cabinet Control Logic
54-20306-01	OCP	Operator Control Panel
70-28574-01	LSB	Centerplane/Cardcage

Table 6-8: XMI PIU parts

Part Number	Mnemonic	Description
T2020-00	DEMNA	XMI to NI Controller
T2027-00	DEMFA	XMI to FDDI Controller
T2028-AA	DWLMA	LAMB Module (Laser to XMI)
T2018	DWVMA	XMI to VME adapter
T2029-AB	KZMSA	XMI/SCSI Controller (AXP only)
T2029-AC	KFMSB	XMI/DSSI Controller (AXP only)
T2030-YA	CLOCK	ARB (Clock & Arbitration)
T2036-AA	KFMSA-BA	XMI/DSSI Controller (VAX only)
T2080-YA	CDKCD-AC	XMI/CI Controller
30-36009-01		Module B (PWR), XMI regulator
30-36010-01		Module A1 (PWR), XMI regulator
70-30396-01		XMI Backplane Assy

**Table 6-9: Futurebus+ PIU parts (AXP only)**

Part Number	Mnemonic	Description
B2003-AA	DWLAA	FLAG module (Laser to FBUS+)
B????-??	DEFAA	FBUS+ to FDDI
30-36009-01		Module B (PWR), Fbus+ regulator
30-36011-01		Module A2 (PWR), fbus+ regulator
54-21662-01		FBUS+ Backplane Assy

**Table 6-10: Disk PIU parts**

Part Number	Description
RZ35-E0	RZ35 Disk Drive (SCSI)
54-19110-01	RZ73 Module
54-19119-01	RF73-EA ECM Module
54-20868-01	Local Disk Convertor
54-21664-01	Disk Control Panel (DSSI)
54-21664-02	Disk Control Panel (SCSI)
70-28814-01	RF73/RZ73 HDA

**Table 6-11: Battery PIU parts**

Part Number	Description
12-36168-02	Battery
12-39982-01	Fuse [LPN-RK-90]
17-03421-01	Battery Sensor Cable
The following parts are all cables:	
17-03492-01	"A" Intermediate
17-03493-01	"B" or "C" Intermediate
17-03494-01	"A" to CEAG (Green Label)-Laser
17-03494-02	"B" to CEAG (Blue Label) -Laser
17-03494-03	"C" to CEAG (White Label)-Laser
17-03496-01	Balancing Cable - Blazer Expander
17-03496-02	Balancing Cable - Blazer Expander
17-03497-01	"A" to CEAG (Green Label)-Blazer CPU
17-03497-02	"B" to CEAG (Blue Label) -Blazer CPU
17-03497-03	"C" to CEAG (White Label)-Blazer CPU
17-03497-04	"A" to CEAG (Green Label)-Blazer Exp
17-03497-05	"B" to CEAG (Blue Label) -Blazer Exp
17-03497-06	"C" to CEAG (White Label)-Blazer Exp

**Table 6-12: Miscellaneous Cables**

Part Number	Description
12-13756-A8	DSSI ground cable (between cabs)
17-00811-03	Console Terminal Cable
17-02382-02	9' External DSSI Cable
17-02382-07	DSSI Brick Jumper Cable
17-03085-01	IO HOSE Cable, Long "114 †
17-03085-02	IO HOSE Cable, Short "53 †
17-03118-01	48V LSB PWR (GRY)
17-03118-02	48V LSB PWR (YEL)
17-03119-01	48V Pwr/Sig PIU (4:1 Cable)
17-03120-01	Sig OCP/CCL
17-03121-01	Sig CCL/LSB Bulk
17-03122-01	Sig LSB Bulk/LSB BP
17-03123-01	Sig LDC/CCL
17-03124-01	Sig AC/CCL
17-03126-01	48V Pwr/Sense Blower
17-03127-01	Pwr 48V AC to LDC
17-03153-01	SCSI Brick Jumper Cable
17-03153-03	9' External SCSI Cable
17-03162-01	Sig X-PIU
17-03163-01	48V Pwr X-PIU
17-03164-01	Pwr +5/+12 LDC/TF
17-03201-01	DEC Power Bus
17-03202-01	Pwr Dist X-PIU
17-03348-01	Sig, DSSI/Bulk (TK85)
17-03415-01	SCSI Bus Cable
17-03416-01	+5vb Jumper X-PIU
17-03417-01	RF73 Signal Cable
17-03418-01	LDC Power Cable
17-03419-01	LDC Signal Cable
17-03420-01	RF73 Power Cable
17-03422-01	Signal & Power Cable
17-03423-01	DCP to B/H
17-03424-01	DSSI Bus Cable
17-03443-01	Pwr LDC/Bulk
17-03444-01	Sig LDC/Bulk
17-03445-01	PWR, LDC to RRD42
17-03448-01	DSSI Bus TF to B/H
17-03505-01	5V VTERM Power Cable
17-03508-01	48V CEAG to B/H
17-03511-01	Expander Cab to Host OCP
17-03531-01	SCSI RRD to B/H
17-03532-01	Storme Signal & Power Cable
17-03533-01	Bulkhead to XMI Signal Cable

† Some 3M cables were mis-labelled 17-03058-xx

## 6.11 Diagnostics and testing

There are no loadable diagnostics for DEC/VAX 7000/10000 systems. There is no VAX Diagnostic Supervisor for the VAXes. All diagnostic testing is done using the console and onboard ROM based diagnostics.

At initialisation the console displays a matrix telling you who's there and who's passed their selftest, similar to the VAX 6000 series. From the >>> prompt you can then run various tests. You can also ">>> set host" to some adapters, to run the onboard RBD tests.

The Pocket Service Guide explains some console commands for testing. For more detail see Console Reference Manual. For LEDs and selftest failures see Advanced Troubleshooting Manual.

Testing under the Operating System can be done with UETP for VAX systems and VET for DEC systems. See Section 6.14.2.4, DEC Verifier and Exerciser Tool (DEC VET).

## 6.12 Troubleshooting Tips

If you replace a CPU, in a multi-CPU system, use the LFU not the console UPDATE command to update the console firmware. See Section 6.7.

If you replace an H7263 regulator, don't forget the 5 delay upon inserting the new one. See Installation Card.

If you're planning a console upgrade make sure a spare CPU is available nearby. Console upgrades can go wrong and most customers don't like having to wait for a replacement from Nijmegen.

Each VAX CPU has a System Identification Register (SID), which contains CPU type and ucode information. When you replace a CPU, or upgrade the ucode, the value of this register will change. This is, of course, supposed to happen, but beware of customers with "SID locked" applications. (See VMS chapter for description of SID).

If you replace or upgrade a CPU in a DEC/VAX 10000 system, make sure environmental variable "system\_variant" is set to 1 afterwards.

If you replace or install a CIXCD-AC in a DEC/VAX 7000/10000 system, remember that it may come with the "wrong sort" of ucode installed. IE: It has AXP ucode and you put it in a VAX, or vice versa. In this case the console will not recognise the option and ">>> show device" will display it as "unknown0". You can still load the correct ucode from the LFU, using the following command.

Function? update unknown0  
You will be asked for the device name, type CIXCD

## 6.13 FCOs

Table 6-13: FCO summary for DEC/VAX/7000/10000

FCO	SB#	Description
7xxx-F001	747	Removing C49 from blower servo stops it self-destructing Quick Check: blowers with serial nos. above 675 or marked with green dots are OK Kit: EQ-01656-01
7xxx-F002	751	New door catches + air pressure switch on CCL bypassed Quick check: door catches at rev D01 and CCL at rev J03 or greater are OK Kit: EQ-01666-01
7xxx-F003	758	Various power parts and cables upgraded to ensure FCC Compliance. Spares only affected Quick check: see FCO document Kit: EQ-01675-xx
7xxx-F004	763	New VAX CPU modules remove memory interleaving restriction and fix Cache ECC problems Quick check: CPU modules (E2045-AA) at rev P07 or higher are OK ① Kit: EQ-01673-01
7xxx-F005	—	New CCL module fixes potential power up problem due to C14 reversed. Only 7xx0s from Ayr between weeks 21 and 31 (1994) are affected Quick check: See FCO document or Section 6.14.3, Other Goodies Kit: EQ-01708-01
10xxx-F001	763	Same as 7xxx-F004, but for 10xxx systems
KFMSB-0001	773	New adapter supports LFU and does 2 byte write properly Quick check: KFMSB-AA (T2029-AC) is rev C02 or higher Kit: EQ-01709-01
KN7AA-O001	773	New DEC CPU fixes memory interleave and cache ECC problems ② Quick check: CPU is E2040-YA at Rev E01 or higher Kit: EQ-01694-01
KN7AA-F002	765	Rev E* LAMB module (T2028-AA) allows byte addressing for BI and VME options on DEC 7000/10000. Spares only affected Quick check: T2028-AA = rev E* Kit: EQ-01686-01, not available in Europe
KZMSA-F001	757	New KZMSA for DEC 7000 systems allows onsite ucode update (via LFU) Quick check: KZMSA modules (T2029-AB) at rev F are OK Kit: EQ-01674-01

- ① The FCO originally said rev P06 modules were OK, but some turned out to have bad TAG RAMs. See FCO document for full details, but basically, modules below rev P06 need replacing, those at P06 *may* need replacing and those above P06 do not need replacing.
- ② Beware, this FCO appeared on SB 776, called 7xxx-F004 and 10xxx-F001. These are the numbers for the VAX CPU FCO!!

## 6.14 Known Features, Restrictions and Problems

### 6.14.1 Console Issues

These are some of the known console issues which might touch an MCS engineer. There are others, so *always* read the release notes for the version of console you are dealing with.

#### 6.14.1.1 BOOTDEF\_DEV restrictions

VAX7000/10000 V1.2 console hangs during boot if string for BOOTDEF\_DEV is greater than 96 characters. V2.4 supported up to 127 (thus allowing 6 devices to be specified), other environmental variables were limited to 31 characters. With V3.\* we are back to only 4 devices being allowed in BOOTDEF\_DEV string. If >>> set bootdef\_dev ... command exceeds one line don't include carriage return, just overtype.

#### 6.14.1.2 DEC7000 console cannot find an OSF/1 dump partition

This problem occurs when OSF/1 is configured to place the dump partition on a disk drive other than the system disk. OSF/1 uses the console's device driver to write the dump, but the console only knows about the boot device. Thus OSF/1 displays "can't open dump device", and the dump is lost.

The following work-around gets the console to configure a path to the disk containing the dump partition *before* it boots OSF/1 from the system disk. It applies to versions V2.5 thru' V4.1. This example powerup script configures all disks on KZMSA1.

```
>>> set mode advance
>>> set eeprom script powerup
Script> set mode advance
Script> kn7aa_pwrup
Script> config kzmsa1
Script> set mode basic
Script> ^z
>>>
```

A permanent fix is planned for a future console release.

#### 6.14.1.3 DEC 7000 consoles and ">>> set host ..." command

Certain versions of DEC 7000 console have trouble with this command:

From V3.0 to V3.2 ">>> set host -dup ..." does not work. (Not sure about earlier consoles). The ">>> cdp ..." command has to be used to configure DSSI disks.

At V3.2 ">>> set host ..." does not work. (V3.0 and V3.1 are OK). This means devices like CIXCDs and DEMNAs cannot be tested using RBDs. The *only* way to test a CIXCD in loopback mode is with the RBDs so you may have to downgrade the console for this.

Both these problems are fixed at console version V4.0.

#### 6.14.1.4 DEC 7000 console V3.2 and OpenVMS AXP V1.5

Depending on CI and disk numbers, OpenVMS AXP V1.5 may not boot after the console has been upgraded to V3.2 or higher. The fix is to install a patch to OpenVMS before upgrading the console.

The patch is on the *Alpha AXP System Firmware Update* CD, and called [DEC7000]AXPAPB01\_015.A. Install it using VMSINSTAL.

#### 6.14.1.5 HALT-RESTART problem in VAX V2.x and DEC V2.1 consoles

When the AUTO\_ACTION environment variable is set to RESTART and the operating systems error-HALTs back to console, the console calls a restart routine stored in the HWRPB. Unfortunately, the console mishandles the program stack and causes another HALT. The second HALT, while a restart is in progress, causes a reboot. The reboot can result in the loss of system crash dumps.

Fixed in VAX 7000 V3.0 and DEC 7000 V2.5 console.

#### 6.14.1.6 Shadowset booting restrictions

There is a restriction with all VAX7000/10000 V2.\* console firmware that when booting from a controller-based shadow set the physical and virtual unit numbers must be unique. This restriction is removed with V3.0.

V3.0 uses the mnemonic 'ds' for controller-based shadow sets and 'du' for physical drives. Unfortunately it has another bug which prevents the use of 'ds' in the BOOTDEF\_DEV string so you cannot setup a V3.0 console to automatically boot from a controller-based shadow set. Boot nickname files work OK, but this means the system will not come up after a crash until someone types >>>Boot "nickname". This is fixed in V3.1.

Use of the boot flags for booting controller-based shadowsets also changed between V2.4 and V3.0. Up to V2.4 the first boot flag only contained the virtual unit number (in HEX) and a bit to indicate shadow set booting. From V2.6 onwards the first flag also contains the physical unit number. So...

```
boot -f1 8DAC,2,0 etc. where DAC = virtual unit no. (3500 in DEC)  
now becomes  
boot -f1 8DAC0000,2,0 etc. where DAC = virtual unit no. and 0000 = physical unit no. 0.
```

#### 6.14.1.7 HSC EDC Errors - VAX7000 Console V1.2 Interaction

HSCs which use K.ci1 (HSC70/40/50) can have data buffer descriptor corrupted by V1.2 console code. This results in EDC errors being detected by the HSCs. Temporary fix is to install following patch, best bet is to upgrade console to V3.0.

This procedure is *ONLY* for VAX 7000 Systems Console V1.2-1931[A14]

After initing the console, do the following commands:

```
>>>set mode advanced #following cmd is advanced  
>>>set eeprom script powerup #open eeprom script buffer  
Script> d 27021 49a2108a #enter deposit cmd  
Script> d 271a3 49a2108a #enter deposit cmd  
Script> ^z #close script (control Z)  
>>>  
>>>show eeprom script powerup #print eeprom script  
  
Powerup Script: #verify that it is correct  
d 27021 49a2108a  
d 271a3 49a2108a
```

At this point only the primary processor contains the change. Use the update -e command now to update the other CPUS, if present

```
>>> init #initialize system
```

Any HSCs which were reporting the EDC errors need to be re-booted to clear corruption in the data buffer descriptor.

#### 6.14.1.8 VAX/DEC7000 consoles will not auto boot via HSC95s after powerup

At powerup, the HSC95 can take up to 3.5 minutes to complete its selftests and become available to the CI. VAX/DEC7000 consoles timeout while attempting to auto boot after a powerup. A manual boot is then necessary.

A workaround is to add the following powerup script which will delay the start of the boot sequence. This script is valid for DEC7000 console V2.5 thru V4.1 and VAX7000 console V3.n. The problem is fixed with VAX7000 console V4.0.

After initing the console, do the following commands:

```
>>> set mode advanced                                #following cmd is advanced
>>> set eeprom script powerup                         #open eeprom script buffer
Script> set mode advanced                            #script needs advanced commands
Script> kn7aa_pwrup                                 #test memory etc.
Script> echo -n "Waiting 120 seconds..." > tt      #tell operator
Script> sleep 120                                    #wait 120 seconds
Script> echo "done" > tt                            #tell operator
Script> set mode basic                             #back to normal commands
Script> ^Z                                         #close script (control Z)
>>>
```

At this point only the primary processor contains the change. Use the update -e command now to update the other CPUS, if present

```
>>> init                                         #initialize system
```

#### 6.14.1.9 VAX 7000 console revision and HSD30

The minimum VAX console revision required to boot a system disk via an HSD30 is V4.0. V3.n consoles cannot "see" devices on an HSD30. Before V4.0 was available the workaround was to connect the system disk via an HSD05. Other disks are not affected as OpenVMS can see them.

#### 6.14.1.10 VAX 7000 and HSJ40, Single Path Booting Problem

As described in Section 6.14.1.11, a VAX 7000 will not boot from an HSJ40 disk if one path to the HSJ40 controller is disabled. Unfortunately, this configuration is needed as a work-around for the HSJ40 "dual receive crash" problem.

The following console patch allows the VAX 7000 to boot over a single path. It should only be installed on systems that boot from an HSJ40 system disk and have console version V3.2-4041[A6]. It must be removed when the console is upgraded. (Use >>> build eeprom, to erase patch).

Execute the following commands to install the patch.

```
>>> set mode advanced
>>> set eeprom script powerup
Script> set mode advanced
Script> kn7aa_pwrup
Script> echo "Applying single path boot patch to V3.2-4041[A6]" > tt ①
Script> d -w 2DBA6 2811 -u
Script> d -l 2dbce 05B13511 -u
Script> d -l 2dbd2 B1471350 -u
Script> d -l 2dbd6 42135011 -u
Script> d -l 2dbda A0C401E0 -u
Script> d -l 2dbde CA11DA00 -u
Script> Set mode basic
Script> ^Z
>>> Set mode basic
```

On multi processor systems use this command to update the other CPUs:

P00>>> update ka7aa\* -e

- This message pops out at Initialise time to tell you the patch is being applied.

#### 6.14.1.11 VAX 7000 fails to reboot from HSJ-40 devices

VAX 7000 V2.X and V3.0, V3.1 consoles don't handle the virtual circuit with the HSC-40 properly when attempting to reboot. This causes the boot to fail like this:

```
P00>>>
Booting...
Connecting to boot device dua403.10.0.13.0
Created device: dua403.10.0.13.0
device dua403.10.0.13.0 not found
failed to open dua403.10.0.13.0
P00>>>
```

The fix is to install VAX7000 Console V3.2. Note a problem still exists when attempting to SHOW DEVICE or boot a drive with PATH A or B disconnected or disabled from an HSJ-40. You must have both paths enabled and connected for the console code to work properly. Alternatively, see Section 6.14.1.10.

#### 6.14.1.12 DEC/VAX 7000 MOP booting problem

Current DEC/VAX 7000 consoles cannot handle MOP Protocol V4. If there is a server *anywhere on the network* which supports V4 Protocol, the MOP boot may fail. Here is an example, seen while booting from an Infoserver 1000:

```
>>>
Booting...
Connecting to boot device exa0
Created device: exa0.0.0.10

Requesting MOP Assistance Volunteer.
MOP Assistance Volunteer found.

Loading...
.Retrying MEM_LOAD...Retries exhausted.
```

bootstrap failure

The following workaround applies to DEC 7000 consoles V3.0 and earlier, or VAX 7000 consoles V3.3 and earlier. This forces the console to request a MOP Protocol V3 boot (which it can handle).

```
>>> set mode advanced
>>> set mopv3_boot 1
>>> set mode basic
```

#### 6.14.1.13 VAX 7000 MOP boot fails with RRD43

Current VAX 7000 consoles on CD fail to boot from an Infoserver, if the CD drive is an RRD43. The ISL loads and runs correctly but when a service on the CD is selected the system halts, thus:

CPU:0 Console entry reason : HALT instruction in kernel mode

Entry PC: 00147691 Entry PSL: 041F0600  
boot failure

The failure occurs because the current ISL file (ISL\_LVAX\_V07) does not work with RRD43s. OVMS Standalone Backup cannot be booted from CD either (as it uses the same ISL file). Once OVMS is up however, the RRD43 can be used normally.

The only workaround, at present is to swap the RRD43 for an RRD42. The ISL file should be fixed in Spring '95.

**Note:** This means that some new VAX 7000 systems, as delivered, cannot be booted!

#### 6.14.1.14 Boot fails due to suspected corrupt EEPROM on VAX 7000

This problem has been seen with V2.4 and V3.2 consoles, but probably applies to others too. A MOP boot fails thus:

```
>>> boot -flag 0,0,0 -file VAX7000_V07_3 exa0
Too many strings
Fail to update eeprom env var on CPU 0
```

Environmental variables can still be manually set and the default ">>> boot" will work. However, there is something wrong with the EEPROM, and this can be fixed with a ">>> build eeprom"; after this the MOP boot will be ok.

**Note:** ">>> build eeprom" causes customer environmental variables to be lost so note them first using ">>> show \*".

#### 6.14.1.15 TEST DWLMA\* fails on VAX 7000s with multiple XMIs

This failure may occur on VAX 7000 systems with 2 x DWLMAs connected as dwlma0 and dwlma1. When they are both tested together using the above command the diagnostic fails as it is finishing, thus:

```
Stopping DWLMA exerciser on dwlma0
Stopping DWLMA exerciser on dwlma1
CPU 0: unexpected exception/interrupt...
[loadza registers...]
Failing FRU: iop0
Catastrophic IO failure, system will be reset
```

Don't panic, this is a diagnostic problem (presumably on all current VAX 7000 consoles). Either test the DWLMAs individually, or move the 2nd hose to IOP slot 3 (makes the 2nd DWLMA dwlma2). The test will then complete correctly.

#### 6.14.1.16 HSD05 slow boot + no auto reboot on VAX 7000

Booting from an RZxx device on an HSD05, over 5DSSI is very slow (6 minutes from VMS banner to next message!). Also, auto reboot fails with the message "Unable to initialise device...". These problems occur with all V3.\* consoles. The following patch can be applied to fix the reboot problem; there is no fix for the slow boot at present. (No mention of either of these bugs in the V4.0 release notes - not sure if they're fixed).

*This patch can only be applied to V3.3 consoles and should only be implemented on VAX 7000/10000 systems that have system disks on an HSD05.*

Execute the flowing commands to install the patch.

```
>>> set mode advanced
>>> set eeprom script powerup
Script> set mode advanced
Script> ka7aa_pwrup
Script> echo "Applying HSD05 reboot patch to console" > tt ①
Script> show device kfmsa*
Script> set mode basic
Script> ^Z
>>> set mode basic
```

① This message pops out at Initialise time to tell you the patch is being applied.

## 6.14.2 Software Issues

### 6.14.2.1 Supported Versions of Operating Systems

For DEC76x0/106x0:

The minimum supported version of OpenVMS AXP is V1.5

The minimum supported version of DEC OSF/1 is V1.2

For DEC77x0/107x0:

The minimum supported version of OpenVMS AXP is V6.1

The minimum supported version of DEC OSF/1 is V3.0

For VAX76x0/106x0:

The minimum supported version of VAX/VMS is V5.5-2HW (special pre-release of V5.5-2)

The minimum supported version of OpenVMS VAX is V6.0

For VAX77x0/107x0:

The minimum supported version of OpenVMS VAX is V6.1

### 6.14.2.2 Operating system .vs. firmware support + PALcode

This table shows which version of console firmware is required for different versions of OpenVMS AXP and OSF/1, plus PALcode on DEC 7000/10000 systems.

Console Rev	LFU	OpenVMS AXP	DEC OSF/1 AXP	PALcode
2.5	AXP7000_V07	1.5	1.2, 1.3	5.41-5/1.28-9
3.0	AXP7000_V08	1.5	1.3, 1.3A, 1.3B	5.44-1/1.32-3
3.1	AXP7000_V09	1.5	1.3, 1.3A, 1.3B, 2.0	5.47-1/1.34-2
3.2	AXP7000_V0A	1.5, 6.1	1.3, 1.3A, 1.3B, 2.0	5.48-1/1.35-1
4.0	AXP7000_V0B/C	1.5, 6.1	2.0, 3.0	5.48-2/1.35-1
4.1	AXP7000_V0D	1.5, 6.1	2.0, 3.0, 3.1	5.48-2/1.35-2

This table shows which version of console firmware is required for different versions of OpenVMS VAX on VAX 7000/10000 systems.

Console Rev (76xx)	Console Rev (77xx)	LFU	OpenVMS VAX
2.4, 2.6	Not supported	VAX7000_V04/6	5.5-2 to 6.0
3.0, 3.1, 3.2, 3.3	Not supported	VAX7000_V07_n	5.5-2 to 6.1
Not supported	1.0, 1.1	VAX7700_V0n	6.1
4.0	4.0	VAX7000_V09	5.5-2 to 6.2

#### 6.14.2.3 VAX 7000 systems may not reboot or write the dump file

VAX 7000 systems using Host Based Volume Shadowing may display the following message during booting:  
"SHADOW-I-VOLPROC, DSAnnn does not contain member named to VMB, Warning system may not reboot or dump".

If a bugcheck or forced crash occurs the system halts and a system dump is not written. This problem only occurs if CSCPAT\_0269021 (patch including SHDRIVER) is installed. Fix is to obtain newer version of SHDRIVER from CSC.

#### 6.14.2.4 DEC Verifier and Exerciser Tool (DEC VET)

This is the Alpha equivalent of UETP. It runs under OpenVMS AXP and DEC OSF/1 operating systems. See *DEC 7000/10000 AXP Technical Bulletin No1* for a brief description of it's use. See *DEC Verifier and Exerciser Tool User's Guide*, AA-PX73A-TE for more details.

DEC VET is included in the OpenVMS and DEC OSF/1 distributions on the Alpha AXP Systems Firmware Update CD. The following table lists recent versions:

Table 6-14: DEC VET vs Operating Systems

DEC VET	OpenVMS AXP	DEC OSF/1	FW CD part number
V3.0	V6.1	V3.0	AA-PTMWM-BE
V3.1	V6.1	V3.0,3.1	AA-PTMWN-BE

#### 6.14.2.5 Corrupt Boot Blocks and WRITEBOOT

During booting 7000/10000 systems get VMB.EXE or APB.EXE from the system disk. The console bootstrap code finds these files by reading the "Boot Block" (block 0) off the disk. Two problems can occur here:

1. The files can move if a defragger is run on the system disk.
2. The boot block can fail to get initialised if the system disk is backed up and not restored properly.

If either occurs the system disk becomes unbootable.

The fix is to run the WRITEBOOT utility which rewrites the Boot Block as shown below.

Example of WRITEBOOT for OpenVMS VAX V6.0:

- + \$ RUN SYS\$SYSTEM:WRITEBOOT
- + Target system device (and bootfile if not VMB.EXE):? \$1\$DUA0
- + Enter VBN of boot file code (default is 1): 1
- + Enter load address of primary bootstrap in HEX (default is 200): 200

Example of WRITEBOOT for OpenVMS AXP V1.5:

- + \$ RUN SYS\$SYSTEM:WRITEBOOT
- + Update VAX portion of boot block (default is Y) : n
- + Update AXP portion of boot block (default is Y) : y
- + Enter AXP boot file : dka100:[VMS\$COMMON,SYSEXE]APB.EXE

The above will put the required good stuff in block 0 of the system disk. However, you will notice that OpenVMS has to be up, which could be a bit of a problem if you can't boot the system disk! If the problem is not spotted until the system/cluster is all down, one of the following options may be your only hope:

- a. Boot Standalone Backup (from a CD).

- b. Load VMB from tape, and then patch registers to boot the system disk (see STARS article "How to load VMB from a TF85").
- c. Move the disk drive to another system.

And then run WRITEBOOT from there.

#### 6.14.2.6 Mandatory Patch for Cache ECC Errors on VAX7000/10000

The Cache error correction routine for the VAX 7000 and VAX 10000 does not properly correct cache single bit errors. Temporary fix is to install one of the following patches:

VAXSYSL13\_U2055 for VAX/VMS V5.5-2  
VAXSYSL01\_060 for OpenVMS VAX V6.0

These patches are in "Mandatory Cache ECC Error Handling Kit", CD-ROM part number AG-PZLBA-BE, and in TIMA. To check if patch is already installed:

```
$ ANALYZE/SYSTEM  
SDA> SHOW SYSLOA  
Verify that:
```

MCHECK1701: X-13A2 (for VAX/VMS V5.5-2)  
MCHECK1701: X-16A1 (OpenVMS VAX V6.0)

Note that if customer upgrades VMS from V5.5-2 to V6.0, the old patch will be lost and the new will have to be installed.

The permanent fix is to do FCO 7xxx-F004.

#### 6.14.2.7 SCSI Disks and Volume Shadowing with OpenVMS AXP 1.5

SCSI devices connected locally to the same AXP host, should not be included in the same shadowset. This can cause bugchecks and "other" failures. Fixed in next release, expected Spring '94.

#### 6.14.2.8 OpenVMS VAX V6.1 Power messages at Boot time on VAX 7000

At boot time we now check power on the 7000 and 10000 platforms. There is a problem in the V6.1 SYSLOA code for VAX 7000 that causes the following error messages, falsely indicating a power regulator problem.

```
%POWER-E-BAD, bad R0=00003003 from CTSR$GETC  
%POWER-I-NOTIFY, central cabinet regulator A event, check errorlog  
%POWER-E-BAD, bad R0=00003003 from CTSR$GETC  
%POWER-I-NOTIFY, central cabinet regulator B event, check errorlog
```

These message may repeat several times. There is nothing wrong with the power. Engineering will produce a patch "soon".

#### 6.14.2.9 OpenVMS AXP and DEC7000 Crash Dump Problems

There are two situations on DEC7000 systems running OpenVMS AXP V6.1 which may cause only partial crash dumps to be written that are no use for analysis:

On systems with large (512MB+) memories, booted from a system disc via the CI, writing the dump may stop prematurely with "Halt Code 05". This is caused by a bug in PNBTDRIVER.EXE. The fix is to apply the following patch kit:

OpenVMS AXP patchkit, AXPBOOT01\_061, available as CSCPAT\_2091.

The second problem involves systems booted via DSSI. Here, if a console key is pressed while the dump is being written, the system may hang. The fix is either not to touch the console, or to upgrade the console firmware to V4.1. If you can't wait for V4.1 a "patched" version of V4.0 is available from:

PROXY"fal\$access"::allen\_public:[public]AXP7\_IPMT\_PC.SYS

### 6.14.3 Other Goodies

I have assembled the following information on known problems from BLITZs, STARS, Notes and local knowledge. Some bits are directly quoted, others I have edited (as you can probably tell!)

#### 6.14.3.1 DEC/VAX 7000 Air Flow Pressure Switch Causes System Shutdown

Air flow pressure switch on the CCL module (DEC P/N 54-20300-01) can cause the system to perform intermittent shutdowns due to false air flow faults. An FCO was issued to replace CCL module (see Section 6.13). Temporary fix is to jumper out the pressure switch.


#### 6.14.3.2 Battery wiring on DEC/VAX 10000s

Failure to observe proper polarity when connecting battery wiring can cause severe power system damage, overheating and emission of smoke. Note that ORANGE wires are POSITIVE (+) polarity and BLUE wires are NEGATIVE (-) polarity. See "DEC 10000 AXP SYSTEM VAX 10000 INSTALLATION GUIDE" (EK-100EB-IN.002), sections 2.15, 2.16 and 2.17.

#### 6.14.3.3 CCL capacitor backwards

A bunch of systems left AYR between WK21 and WK31 of 1994 with capacitor C14 on the CCL module reversed. Most of these systems have been traced by DECnumber, so I mention it here just in case one or two slip through and cause subsequent problems. When the capacitor fails it will prevent the system from powering up. Thus it's failure will only show up when the system is next powered down! Now fixed by FCO 7xxx-F005 (see Section 6.13).

This is the correct orientation of C14:

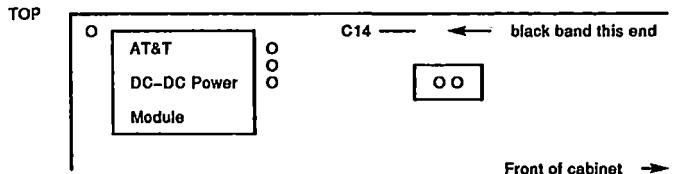

#### 6.14.3.4 CIXCD Microcode on Alpha/VAX VMSclusters

Only the CIXCD-AC (T2080-YA module) is supported with the Laser platform. It normally comes loaded with VAX compatible ucode (CIXCD.BIN). However, DEC7000/10000 systems need *different ucode* that is AXP compatible (CIMNA.BIN). Factory installed options will be OK, but if you install one you must run the LFU to load the correct ucode. Field spares could have either ucode on board so be careful.

#### 6.14.3.5 VAX 7000/10000 CIXCD Write Error Interrupt (WEI) Errors

While booting a VAX 7000/10000, VAX-VMS creates two error log entries that are caused by the CIXCD testing WEI (write error interrupt) logic. The error log entries appear to be reporting a real error when they are actually reporting a selftest diagnostic activity. If the errors have the following footprint, you can safely ignore them.

The errorlog entries only occur when the system is being booted

The date is always - 1-JAN-1992 00:00:00.00

First errorlog is - ADAPTER ERROR KA7AA-AA

XBER contains - Enable More Protocol & Write Error Interrupt & Error Summary

Second errorlog is - MEMORY CONTROLLER ERROR KA7AA-AA

#### 6.14.3.6 DEC7000 with >2GB memory, CIXCD, running OpenVMS, may crash

On the DEC7000/10000, the CIXCD does not handle addresses above 2 gigabytes correctly for a special case. The symptoms are a system crash, with a reference to non-existent memory.

For systems running OpenVMS with adequate non-paged pool there will not be a problem. One workaround, therefore, is to ensure that the OpenVMS sysgen parameters are adjusted to create sufficient non-paged pool to cover the system's heaviest load periods. Alternatively, a corrected version of the CIXCD microcode can be obtained from:

PROXY"FA1\$ACCESS":CI\_PUBLIC:[PUBLIC]CIMNA\_X12.SYS

This is a MOP bootable LFU image containing only the new CIXCD microcode. The corrected CIXCD microcode will be included in a regular release of the LASER Firmware Update Utility (LFU) currently targeted for February '95.

#### 6.14.3.7 DEMFA Firmware V2.0 and OpenVMS AXP V1.5

The latest DEMFA firmware is V2.0, and spare modules are likely to come with this version. Unfortunately OpenVMS AXP V1.5 can only recognise DEMFA firmware up to V1.4. So if you replace a DEMFA, you may have to downgrade it to V1.4 firmware, using the LFU.

#### 6.14.3.8 DSSI PIU Disk Brick Gotcha

On the front of each DSSI disk brick are two sets of indicator switches, one for each drive. At first glance they look like LEDs, but in fact they are also pushbuttons. So, if your drive won't power up, you probably need to operate the "power" pushbutton. See *DEC/VAX 7000 Pocket Service Guide* or *BA654, DSSI Disk PIU Installation Guide* for a full description.

#### 6.14.3.9 EF51R-LA and EF52R-LA Disks VAX 7000/10000 Systems

Early KA7AA/E2045 console code does not support the EF51R and EF52R DSSI drives. Fixed in version 3.0 of console.

The hole around the Node-ID connector on the EF51R and EF52R drives does not allow the cable to be installed properly. (You have to "gently push" it).

VMS V5.5-2 does not support ERF (Error Formatter) for the EF51R and EF52R disk drives. VMS V6.0 does.

#### 6.14.3.10 KFMSA reports "Invalid Buffer Name" errors on busy VAXes

These errors can be logged in the errorlog of VAX 7000/10000s during heavy I/O activity. At the same time a message is displayed on the console saying the port will be re-initialised and all the drives associated with the KFMSA do a mount verification. So far these errors have only been seen on systems with dual XMIs, fully loaded with KFMSA-BAs.

The fix is new ucode for the KFMSA-BA. However this has not been made available for general distribution as it does not work on VAX66xx systems. It can only be obtained directly from Engineering. If your system suffers from these errors contact me, or your local Support engineer.

#### 6.14.3.11 KFMSB Cable kit

The XMI backplane to DSSI bulkhead cable kit for a KFMSB (AXP XMI to DSSI adapter) is different to that for a KFMSA (VAX XMI to DSSI adapter). Use of the wrong one damages the modules, so be careful when doing an upgrade.

#### 6.14.3.12 KZMSA and TZ85/6/7s give errors on OSF systems

If tape is written with one record size and read back with a smaller record size, the last data buffer of the transfer is not returned completely. Problem has been seen with TAR utility and TAPEX exerciser under OSF V1.3. Only occurs with KZMSA firmware earlier than X046.

Fix is to upgrade KZMSA to X046 firmware using the LFU. A mop bootable LFU image (KZMSA\_X046.SYS) can be copied from:

PROXY"HAL\$ACCESS":LASER\_CONS\_PUBLIC:[PUBLIC]KZMSA\_X046.SYS

Note: KZMSA modules at rev. E or earlier do not have firmware loadable via LFU. FCO KZMSA-F001 would then be required.

#### 6.14.3.13 KZMSA revision for OSF/ASE

ASE V1.1, an OSF layered product, needs the KZMSA (T2029-AB) to be rev F03 or later. The installation fails if it is not. If the KZMSA is rev F02 or F02 it can be upgraded by fitting a new EPROM (23-419E9-00) in E7. If it is rev F01 or earlier it must be replaced.

#### 6.14.3.14 Vital Information In Laser Errorlogs

There is a process whereby Operating System errorlog information can be placed in the EEPROMs of Laser CPUs. These logs (called rather confusingly SDD) are a great help to the repair centres. This process was not supported by VMS before version 6.0 and OSF/1 version ??? So the message is: include a hardcopy of the errorlog with any CPU module you return (always a good idea anyway).

#### 6.14.3.15 LFU Version 5.2 revision reporting

The SHOW command under version 5.2 of the LFU will sometimes incorrectly display the CPU hardware revision. Ignore this figure, get revision from CPU module. Later versions of LFU get it right.

#### 6.14.3.16 Async '05 Machine Checks on Multiple CPU VAX7000/10000s

DSM and other applications may experience Async '05 Machine Checks running in an SMP environment. Stack frame shows failing opcode of 5D, an INSQTI instruction. Fixed by V2.6 of VAX7000/10000 console.

#### 6.14.3.17 MS7AA-FA SIMM Isolation on DEC 76/7700 from OpenVMS AXP errorlog

When a memory CRD error is logged for the 2GB array, the error formatter may not give the information required to identify which SIMM is at fault. A manual procedure for decoding the errorlog entry and locating the SIMM is described in the MS7AA-FA Memory Module Service Manual.

#### 6.14.3.18 VAX 7000 upgrade gotcha

When the VAX 7000 was first announced, the maximum supported number of CPUs was 4 (IE: a 7640). Now 6 CPUs are supported (IE: a 7660). Unfortunately this required a change to the CPU module, making it a -AB variant. This means upgrading a 7640 to a 7650 or 7660 may mean replacing all the CPUs as only E2045-ABs will work. (E2045-AAs are fine for 7610s thru 7640s).

#### 6.14.3.19 DEC OSF/1 AXP PRESTOSERVE memory option MS7BB

This is a 16 MB battery backed up memory which sits in the LSB backplane. It's onboard battery will "keep" data for up to 48 hours of power outage. It is used with OSF/1 as a cache for disk I/O (now you know why it's got BBU!) and, as this speeds things up a bit, it is also known as PRESTOSERVE.

Installing and servicing this option is a bit more exciting than ordinary memories, so make sure you read *The DEC OSF/1 guide to PRESTOSERVE (AA-PQT0A-TE)*, and the MS7BB section of *DEC 7000/10000 AXP Technical Bulletin No2*, before you try it.

The DEC7000/10000 implementation consists of an option: DJ-70APS-AA. This includes the MS7BB-AA, a PAK for the PRESTOSERVE license and installation documentation. DJ-70APS-AA requires a minimum revision matrix of console, OSF, and CPU module for system compliance. (To work they mean!) Systems below revision must be upgraded before the option is installed.

**Table 6-15: Minimum system revisions for PRESTOSERVE support**

	DEC7000-600	DEC10000-600
CPU Module:	E2040-AB Rev A01	E2040-YA Rev C01
PRESTO Memory:	E2049-AA Rev C03	same
Console:	V3.0	same
OSF:	V1.3.4	same

#### 6.14.3.20 DEC/VAX 7000/10000 Memory Interleaving restriction

A problem with the LEVI-A chip on early CPU modules results in the following memory configurations *only* being allowed.

- 1, 2 or 4 of the same size modules, up to max of 512 MB
- 1 x 128 MB + 2 x 64 MB modules
- 1 x 256 MB + 2 x 128 MB modules

An unsupported configuration results in the following console message at boot time: "Invalid memory interleave—boot disallowed".

Fixed on VAX 7000/10000 by FCO 7xxx-F004 (see Section 6.13). No fix for DEC 7000/10000s at present.

#### 6.14.3.21 RZ57s on ALPHA platforms.


RZ57s on DEC 7000 systems must be rev. D01 (rev. 6000 ucode) or above. Lower revs. can suffer undetected write faults. An EQ kit has been proposed, but *not* for an FCO. Customers are expected to *buy* it!

#### 6.14.3.22 RF73s in VAX 7600 SF73LA, cable problem

The flex cable at the rear of the RF73 can get damaged if the drive is positioned too far back on it's skid plate. The drive should be mounted using the third set of holes from the front.

#### 6.14.3.23 VMS gains time

Some VAX 7000 systems experience a problem where VMS system time gains by more than 9 sec per day (the quoted tolerance). This is fixed by a REV N06 KA7AA (E2045-AA) CPU module. If module can't be replaced, customer can run a batch job to do SET TIME every 12 hours.

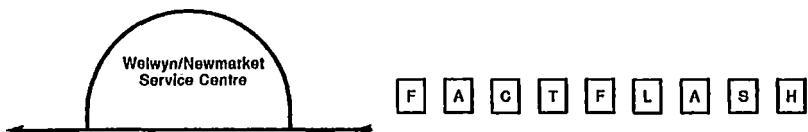

Options Affected: VAX7000-6xx  
Submitted By: Dave Bazley  
Date: 22-Dec-1993  
Filing Instructions: File at end of Chapter 6, DEC/VAX 7xx0/10xx0

#### VAX 7000 FCO (7XXX-0004/10XXX-0001) Warning

The above FCO is just starting in Europe. It removes memory interleaving restrictions and corrects cache ECC error handling problems. The FCO replaces the CPU module(s), E2045-AA, with one(s) at rev. P06. Manufacturing started using rev. P06 modules back in June. Unfortunately a batch of these had bad Tag RAMS. So now we have to check **all** systems and apply the FCO as follows:

- If CPU module(s) are below rev. P06, do the FCO.
- If CPU module(s) are at rev. P06 but contain bad Tag RAMs, do the FCO.
- If CPU module(s) are at rev. P06 and contain good Tag RAMs, the FCO is not required.

The FCO Document explains how to check for the above criteria.

A number of additional 'gotchas' are inherent in this FCO:

- The EQ kits *currently* contain CPU modules with rev. 3.0 console code onboard. This rev. of console has some restrictions around booting controller based shadowsets, HSC95s and HSC-40s (see 6.6.2, Console Issues and 6.13.2, Known bugs). Rev. 3.1 and 3.2 consoles remove some of these restrictions.
- The only reliable way to change the rev. of a console is with the LFU. This means you must have the LFU and the latest revs of console code, onsite. 3.1 and 3.2 are not available on CD (yet), so you have to get them off the network and on to the customers Infoserver (see 6.8.2, Putting a service on the Infoserver...)
- Changing the console code has its own set of pitfalls, each rev has different idiosyncrasies, and there is no guarantee that new modules will always arrive containing rev. 3.0 even!
- CPUs in multi-CPU systems must all be at the same rev. so they must all be FCOed together.
- The SID will change

PTO

So only attempt this FCO if:

1. You're 7000 trained.
2. You've successfully upgraded a 7000 console before.
3. You've read the FCO Document, this factflash and the relevant parts of chapter 6 and understood what they're telling you.
4. You've discussed any console restrictions with the customer and made sure they will not be a problem. (Don't forget the SID).
5. You like a bit of adventure!

If you're lucky enough to work at Newmarket or Welwyn, I can supply you with any console you need (the latest lives in the Datadoc Media Cabinet). I'd be pleased to discuss any queries you have regarding this FCO and would be happy to go to site as well if necessary.



Options Affected:

DEC/VAX 7xx0/10xx0

Submitted By:

Dave Bazley

Date:

23-MAR-1994

Filing Instructions:

File at end of chapter 6, DEC/VAX 7xx0/10xx0


#### CCL Interconnect Diagram

Those of you who work on 6xx0 systems will know that the "System Interconnect Diagram" can be quite useful for chasing power and control signals around inside the platform cabinet.

Overleaf is the best equivalent I have found so far for the 7xx0/10xx0 platform. It is a block diagram rather than a wiring one, and so does not contain as much detail as the 6xx0 version. However, it does give some idea of what goes where.

I found it in the *Laser System Specification*.

CCL Interconnect Diagram

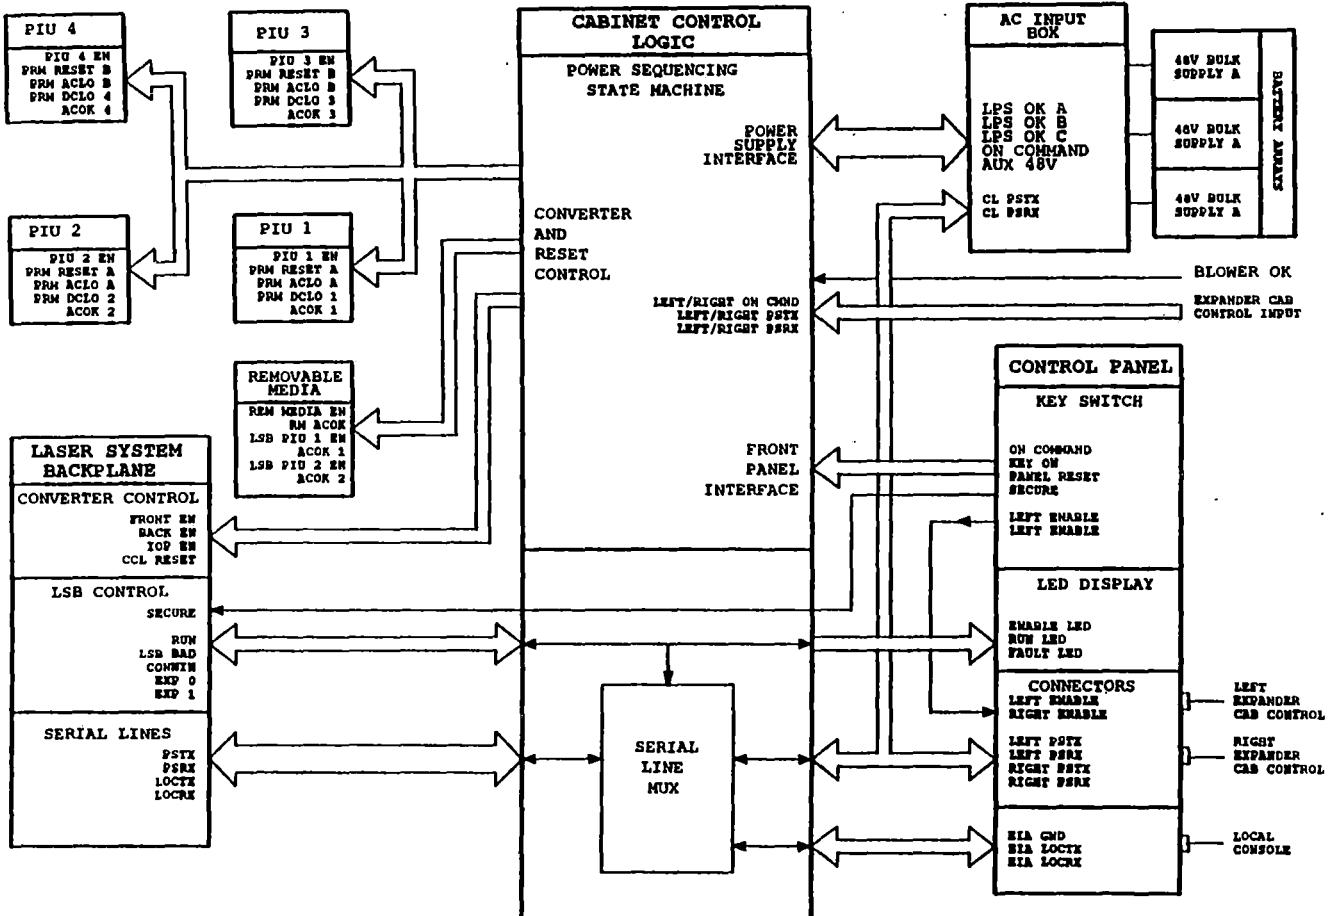

Welwyn/Newmarket  
Service Centre

F A C T F L A S H

Options Affected:

VAX 7000/10000

Submitted By:

Dave Bazley

Date:

20-SEP-1994

Filing Instructions:

File at end of Chapter 6, DEC/VAX 7000/10000


#### Locating Bad Chips on rev P06 CPU Module

The current FCO, 7xxx-F004 requires rev P06 VAX 7000 CPU modules to be checked for bad Tag RAM chips. Up to now locating these chips has been difficult because we have had no board layouts showing their positions. Now, thanks to Mr Bruno Zago, we have!


Remember that *only* P06 modules need this check, lower revisions definitely need the FCO, higher revisions definitely don't.


The chips to look for are marked in the drawings. There are four on the front of the module and five on the back. *If* the chips are marked MCM6709A10 *and* the build code begins with "T", they *are* defective and the module should be replaced.

Front:

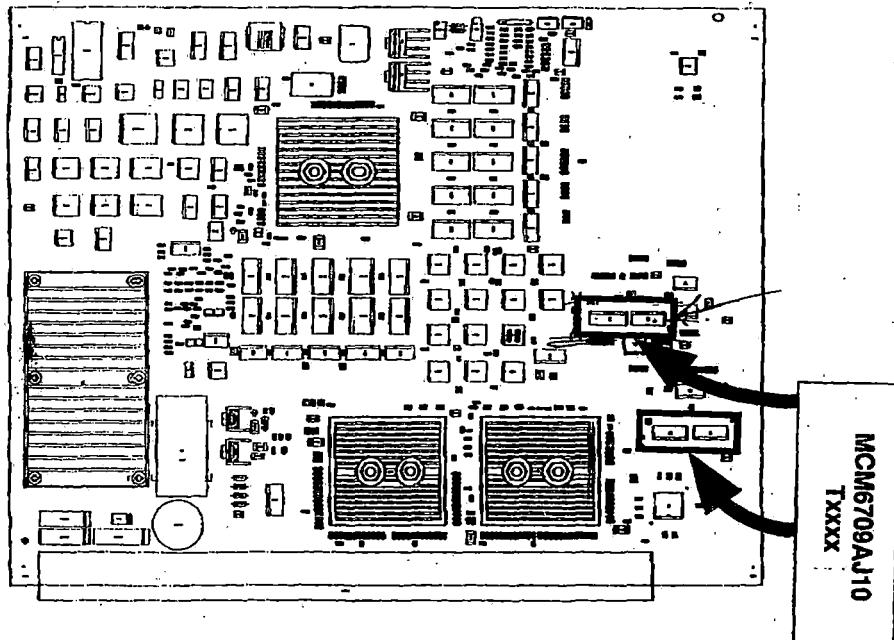

Back:

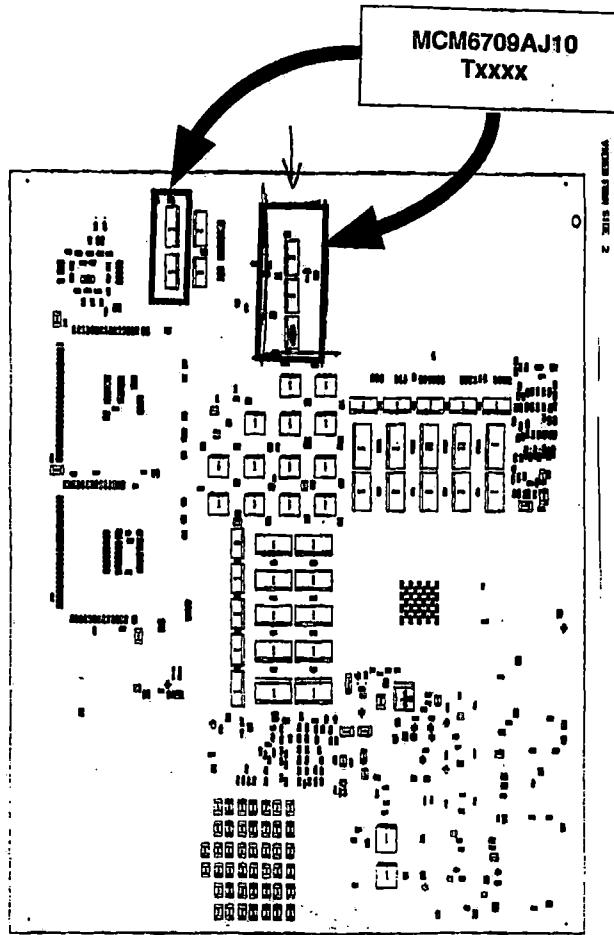

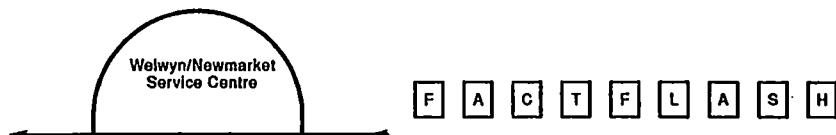

Options Affected: **Alphaserver 8000**  
Submitted By: **Dave Bazley**  
Date: **01-May-1995**  
Filing Instructions: **File at end of Chapter 6, DEC/VAX 7000...**

### Introducing the Alphaserver 8400 and 8200 (Turbolaser)

Two new high-end Alpha systems are due out soon. They are described as "Enterprise Servers" and are Digital's most powerful systems to date. They share some features with DEC 7000s but in other ways are different. There are no VAX versions of these systems. The codename for both systems is Turbolaser.

You may have already read about these products during their development. This Factflash briefly describes each one as they will first ship.

#### Alphaserver 8400 Model 5/300

A high-end Datacentre server, positioned as a mainframe alternative. The "5" denotes EV5, the latest Alpha chip, the "300" denotes the CPU clock speed of 300 MHz. This system was previously named Alphaserver 21000. Its key features are as follows:

- Same cabinet as DEC 7000
- Same power and cooling as DEC 7000 (+ new single phase option)
- Same control panel as DEC 7000 (+ CD and 3.5" floppy)
- Same I/O PIUs as DEC 7000 (XMI, FB+, Disks, Batteries) + new PCI PIU (DWLPA)
- New 9 slot centreplane and card cage
- New System Bus, TLSB, faster (>2 GB/sec) and wider than LSB
- New CPU, Memory and I/O modules:
  - + CPU module: TLEP, 2 x EV5 CPU chips, 2 x 4 Mb BCache, up to 6 in system giving 12 CPUs
  - + Memory module: TMEM, motherboard with SIMMs, 64MB/128MB/256MB/512MB/1GB/2GB available, up to 7 in system giving 14GB
  - + Two types of I/O module:
    - TIOP, 4 x hose, supports XMI, FB+, PCI and Memory Channel (Reflective Memory) adaptors
    - ITIOP, 1 x hose, 3 x FWD SCSI-2, 1 x single-end SCSI-2, 2 x twisted pair Ethernet, add-on options of NVRAM and FDDI, all on one module!
  - Up to 3 in system
- New Clock Module at end of TLSB (does not use a slot), no clock on TIOP or ITIOP
- EISA as PCI option

- Up to 190+ GB (48 x 3.5" drives) of internal SCSI storage
- Minimum Operating Systems: OpenVMS AXP V6.2 and DEC OSF/1 V3.2 HW4
- Faster, bigger and cheaper than IBM RS6000, Sun SPARCcenter 2000 and HP T500 (in an independant survey folks!)

#### **Alphaserver 8200 Model 5/800**

A high-end departmental server for the open office environment. This system was previously called the Alphaserver 20000. It's key features are the same as the Alphaserver 8400, except:

- New rackmount cabinet
- 5 slot System Bus
- Up to 3 CPU modules giving 6 CPUs
- Up to 3 Memory modules giving 6 GB
- A storage drawer for CD and RZ drives
- Up to 3 PCI shelves or 6 StorageWorks shelves
- New power, cooling and control panel
- No PIUs
- New regulator(s) with optional BBU inside

If you'd like to know more, a preliminary CBT is available. See your local 7000 support engineer.